

U.S. PUBLIC LAND CORNER MAINTENANCE

48

Corner ID: N1/4 Sec. 16, T18N-R1W

21801090020

DATE	CREW	MONUMENT TYPE-----
October 9, 2019	Zachariah P. Dechant Gary L. Dechant	Monument destroyed. Reset with mag nail from previous survey 5 CSM P 39 Doc. No. 362370 28 CSM P 11 670108 and 1993 notes on 1975 tie sheet. 12' west of centerline USH "12". 145' north of driveway 9030 USH 12, east of hwy.

References:

	<u>Bearing</u>	<u>Distance</u>
1) Set 3/4x24" round iron bar, down 10", (not on section line) edge of field, 7'N. of 18" White Pine,	East	84.63'
2) Set 3/4x24" round iron bar, down 6", 9' NW of 20" Spruce	S 60 E	68.14'
3) Set 3/4x24" round iron bar, down 6",	West	68.87'
4) Existing 3/4" round iron bar, with steel post, NW corner CSM	West	279.92'(279.82')
5) Existing 3/4" round iron bar, NE corner CSM, (r/w monument 41.25' west of hwy) new sign set	West	29.82 (29.82')
6) Set 3/4x24" round iron bar, down 10" in field	N 60 W	54.04'

Corner and reference markers set on straight lines.



CERTIFICATE

UPDATED
CERTIFIED LAND CORNER



I, Harley Sime, do hereby certify that on the _____ day of _____ 19 74, I found (evidence) ~~(no evidence)~~ of the N 1/4 corner of Section 16, T 18 N, R 1 W, Fourth Principal Meridian, and I re-established said corner according to the Wisconsin Statutes as shown and described hereon.

Dated this 27 day of Feb 1975.

Harley Sime
County Surveyor
Title

History of original corner establishment:

Description of corner evidence found:

Found existing 3/4" iron bar in fence line and replaced it with a Harrison monument. Distances to this point checked with previous surveys.

UPDATE: A resurfacing project was to take place in the summer of 1993. Prior to construction, the distances to previous ties were checked and a new tie taken. The Harrison was then removed. Following the resurfacing project, a 1/4" x 30" round iron bar was set at the corner location.

Description of corner and witness monuments, references and accessories used to perpetuate the original or re-established location of this corner:

Witnesses to corner location:

SURVEY CREW

K. Pritzlaff - Survey Crew Chief


D. Malliet

B. Jung W.C. Jung

A. Lueck


1993 CREW: Bryan Meyer, Rick Lobe
July 7, 1993

See Reverse Side
For Maintenance

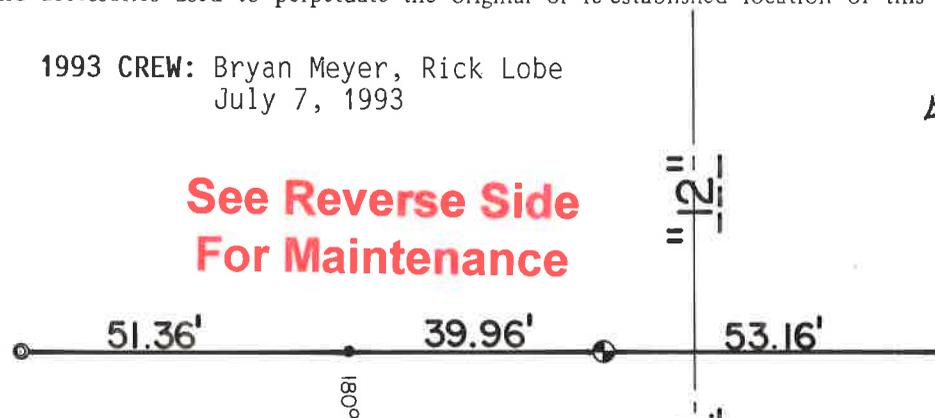

Ex. sign here.

- ⊕ = Set 1/4" x 30" round iron bar
- ⊙ = Set 1/4" x 24" iron pipe
- = Existing 3/4" round iron bar

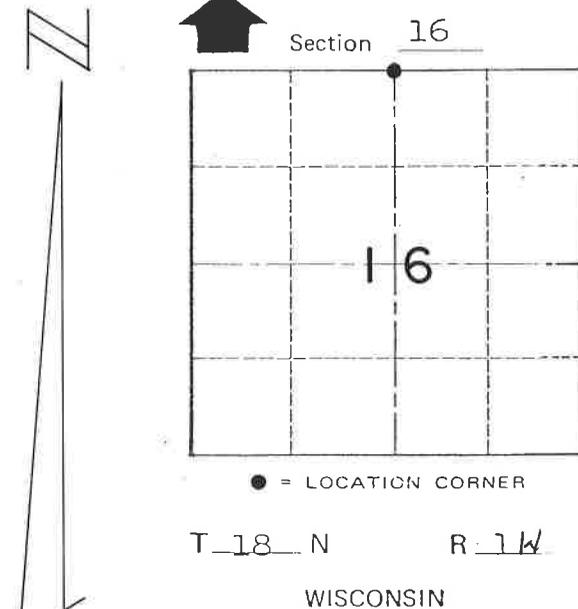

SURVEY CONTROL ORDER

Horizontal	_____
Vertical	_____

WISCONSIN COORDINATE SYSTEM

Corner	East (X)	North (Y)	Elevation (Z)	Zone
Control Sta. Name				

City, Village or Town La Grange
County of Monroe

COUNTY SURVEYOR FORM NO. 1

CERTIFICATE

CERTIFIED LAND CORNER

No. 48
Sec Pg. 2



I, Harley Sime, do hereby certify that on the _____ day of _____ 1974, I found (evidence) (~~no evidence~~) of the N 1/4 corner of Section 16, T 18 N, R 1 W, Fourth Principal Meridian, and I re-established said corner according to the Wisconsin Statutes as shown and described hereon.

History of original corner establishment:

Description of corner evidence found:

Found existing 3/4" iron bar in fence line and replaced it with a Harrison monument. Distances to this point checked with previous surveys.

Dated this 27 day of Feb 1975.

Harley Sime
County Surveyor
Title


COUNTY SURVEYOR FORM NO. 1

Description of corner and witness monuments, references and accessories used to perpetuate the original or re-established location of this corner:

Set standard Harrison monument down 4" below gravel in shoulder of road.
Accessories are as follows :


Witnesses to corner location:

SURVEY CREW
K. Pritzlaff - Survey Crew Chief
D. Malliet
B. Jung *W.C. Jung*
A. Lueck

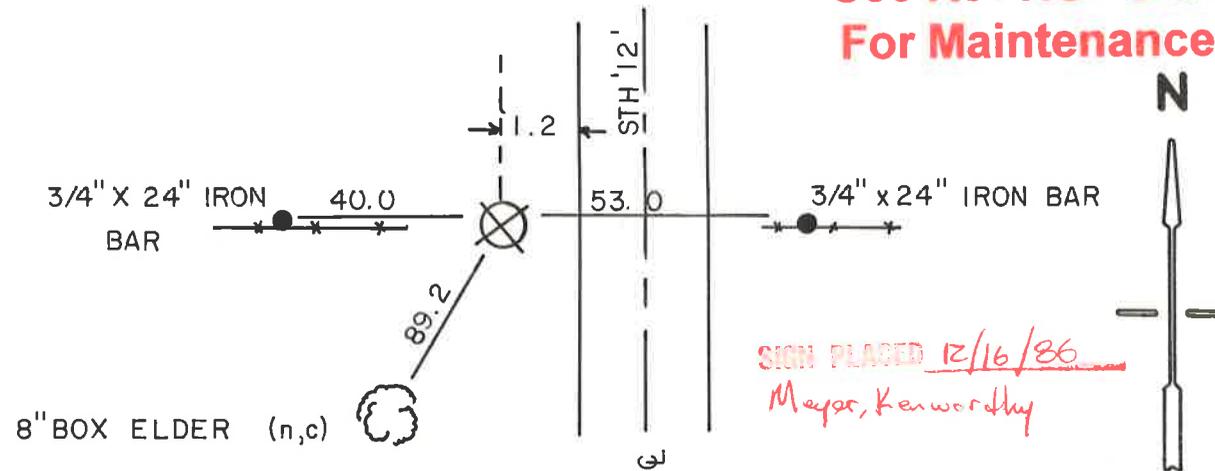

See Reverse Side For Maintenance

SIGN PLACED 12/16/86
Meyer, Kenworthy

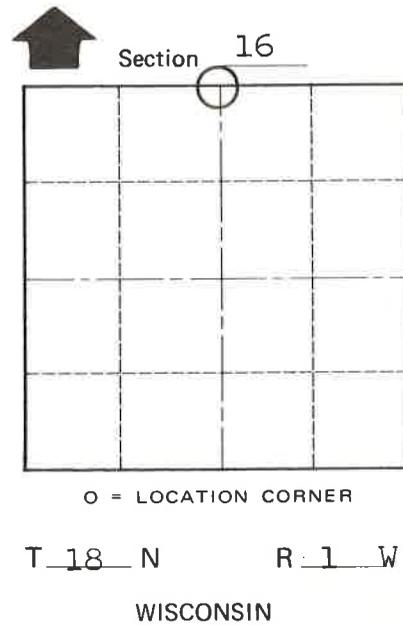

O = LOCATION CORNER

T 18 N R 1 W
WISCONSIN

SURVEY CONTROL ORDER

Horizontal _____
Vertical _____

WISCONSIN COORDINATE SYSTEM

Corner	East (X)	North (Y)	Elevation (Z)	Zone
Control Sta. Name				

City, Village or Town La Grange
County of Monroe