

VERNON COUNTY CERTIFIED U.S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: THIS RECORD SHALL SHOW THE LOCATION OF THE CORNER AND SHALL INCLUDE ALL OF THE FOLLOWING ELEMENTS (A-I)

(A) IDENTIFY THE CORNER BY REFERENCE TO THE U.S. PUBLIC LAND SURVEY SYSTEM

■ = CORNER MONUMENT RESTORED

WITNESSES TO CORNER LOCATION:

- 1) Robert M. Lampman
- 2) Jessica A. Zamor

VERNON COUNTY COORDINATES - NAD83(1991) - SURVEY FEET


NORTHING: 211022.198

EASTING: 777912.943

MONROE COUNTY COORDINATES - NAD83(1991) - SURVEY FEET

NORTHING: 300093.967

EASTING: 681461.678

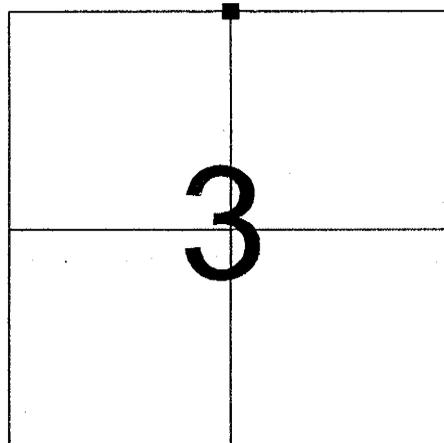

SECTION 3
TOWN 14 NORTH, RANGE 2 WEST

(B) DESCRIBE ANY RECORD EVIDENCE, MONUMENT EVIDENCE, OCCUPATIONAL EVIDENCE, TESTIMONIAL EVIDENCE OR ANY OTHER MATERIAL EVIDENCE YOU CONSIDERED, AND WHETHER THE MONUMENT WAS FOUND OR PLACED.

Accepted location of existing U.S. Army Corps of Engineers monument (iron pipe with brass cap) as best available evidence of the original government corner location.

(See corner history on reverse side of sheet.)


(C) IN THE PLAN VIEW DRAWING BELOW, PROVIDE REFERENCE TIES TO AT LEAST 4 WITNESS MONUMENTS OR, IF THE LOCATION IS WITHIN A MUNICIPALITY, TO AT LEAST 2 WITNESS MONUMENTS. (WITNESS MONUMENTS SHALL BE MADE OF CONCRETE, NATURAL STONE, IRON, OR OTHER EQUALLY DURABLE MATERIAL.) DESCRIBE WITNESS MONUMENTS.

(D) SHOW A PLAN VIEW DRAWING, DEPICTING THE RELEVANT MONUMENTS AND REFERENCE TIES, WHICH IS SUFFICIENTLY DETAILED TO ENABLE ACCURATE RELOCATION OF THE CORNER MONUMENT IF IT IS DISTURBED.

LEGEND

- FOUND EXISTING IRON PIPE WITH BRASS CAP (U.S.A.C.E)
- SET 3/4" X 24" ROUND IRON BAR FOR WITNESS MONUMENT

NOT TO SCALE

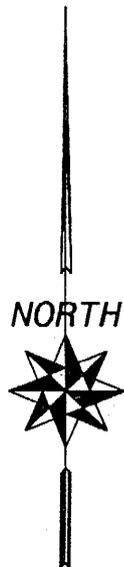

PASTURE

PASTURE

WOODED

Set 2" Channel Post with Sign 1.7' ± North of Corner

N 40° 48' 15" E 28.24'

S 75° 09' 13" E 16.79'

S 33° 23' 16" W 24.24'

S 04° 53' 39" E 26.68'

Set 3/4" Iron Bar 3'± West of 8" Box Elder

Set 3/4" Iron Bar 4'± North of 13" Box Elder

Set 3/4" Iron Bar 6.3'± South of 2" Ash

Set 3/4" Iron Bar 3'± East of Double Box Elder

Remains of Fence & Tree Line Running South

Notes: Monument Appears to Be Very Stable and Solid - Approximately 9-1/2" of The Monument is Exposed Above Ground & Corner is Located Approximately 120' Easterly of the Creek

(E) DESCRIBE ANY MATERIAL DISCREPANCY BETWEEN THE LOCATION OF THE CORNER AS RESTORED OR REESTABLISHED AND THE LOCATION OF THAT CORNER AS PREVIOUSLY RESTORED OR REESTABLISHED BY DISTANCE AND DIRECTION. SHOW THE DISCREPANCY ON THE PLAN VIEW DRAWING UNDER (D), ABOVE. SHOW THE DISTANCES BETWEEN THE CORNER AS PREVIOUSLY RESTORED OR REESTABLISHED AND (1) THE CORNER AS RESTORED OR REESTABLISHED, AND (2) TO AT LEAST 2 OF THE WITNESS MONUMENTS AS SHOWN ON THE DRAWING IN (D), ABOVE.

N/A

(F) WAS THE CORNER RESTORED THROUGH ACCEPTANCE OF (1) AN OBLITERATED EVIDENCE LOCATION, OR (2) A FOUND PERPETUATED LOCATION?

(2) A FOUND PERPETUATED LOCATION

(G & H) WAS THE CORNER REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS? IF SO SHOW THE METHOD, INCLUDING THE DIRECTIONS AND DISTANCES TO OTHER PUBLIC LAND SURVEY CORNERS USED AS EVIDENCE OR USED FOR PROPORTIONING IN DETERMINING THE CORNER LOCATION.

N/A

(**) ANY ADDITIONAL INFORMATION RELATED TO CORNER LOCATION

CORNER HISTORY:

-Original government corner location established by Uriah Biggs in 1845.

-W.H.Knower utilized the corner during a subdivision of Section 3, T14N, R2W dated June of 1878. Knower's survey lists the corner as government and does not include notation of a monument at the corner or any witnesses.


-Ralph J. Van Dorpe, Illinois Registered Land Surveyor for the U.S. Army Corps of Engineers reestablished this corner as part of a property survey for the Kickapoo River Reservoir during 1965 and 1966. Plat of Survey prepared by Van Dorpe calls for an iron pipe with brass cap at this corner. Van Dorpe reestablished the corner location by acceptance of the occupational evidence. The accepted fence as corner shown on Van Dorpe's map was a two-way fence corner with fences running north and east.

-F. Curtis Crook showed an existing 2" iron pipe with brass cap on a Plat of Survey located in part of Section 34, T15N, R2W dated July 7, 1993.


-Gary L. Dechant shows an existing iron pipe with brass cap at the corner on Vernon County Certified Survey Map Volume 3, Page 132, Doc.No. 347475, dated December 22, 1994, Vernon County Certified Survey Map Volume 3, Page 259, Document No. 355324, dated March 13, 1996 and Vernon County Certified Survey Map No. 59, Volume 4, Page 143, Document No. 364655, dated December 19, 1997.

AFFIX LAND SURVEYOR SEAL

(I) I, ROBERT M. LAMPMAN, CERTIFY THAT THE LOCATION SHOWN ON THIS RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.


SIGNATURE

3-10-04
DATE

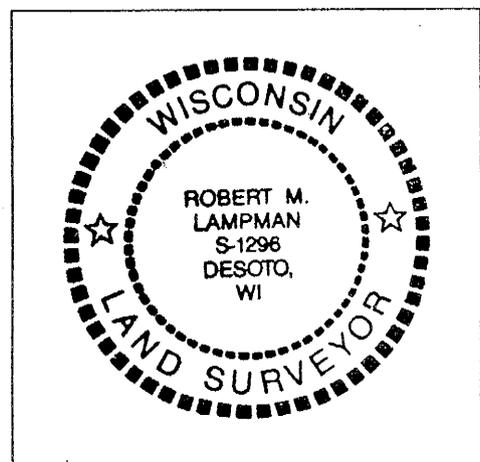

I, William C. Jung, do hereby certify that on the twenty-sixth day of March 1980, I found (evidence) ~~(no evidence)~~ of the South 1/4 corner of Section 34, T15 N, R2 W Fourth Principal Meridian, and I re-established said corner according to the Wisconsin Statutes as shown and described hereon.

History of corner establishment since Original Government Survey

The U.S. Army Corps of Engineers set a 2 1/4" capped iron pipe at this corner in 1965.

Description of corner evidence found:

I found the U.S.A.C.E. pipe and accepted it as the corner.

Dated this 16th day of Jan. 1981.

William C. Jung - William C. Jung
Registered Land Surveyor
Title

COUNTY SURVEYOR FORM NO. 1




Description of corner and witness monuments, references and accessories used to perpetuate the original or re-established location of this corner:

Witnesses to corner location:

William C. Jung

Carlton R. Pietz

Malcom S. Sowers

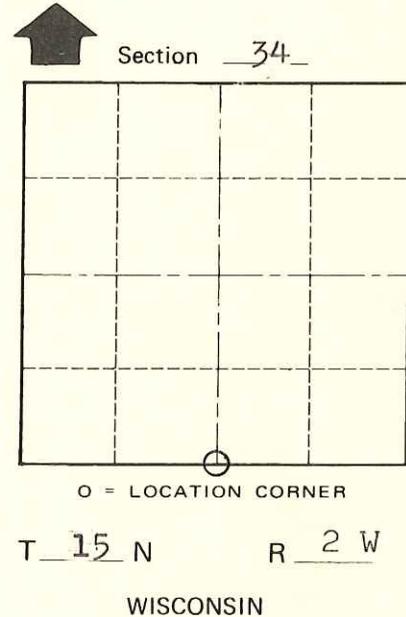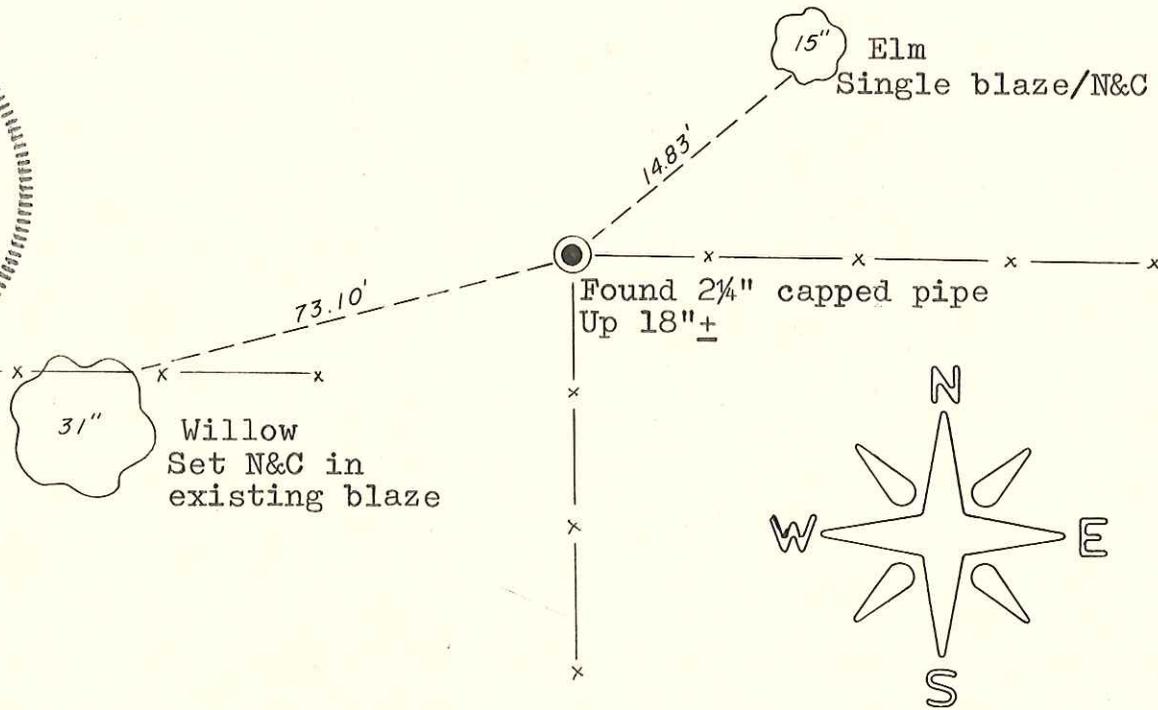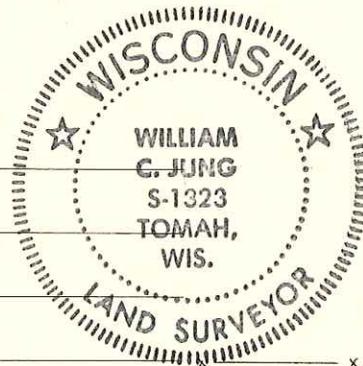

Approved: **HARLEY A. SIME**
MONROE CO. SURVEYOR

SURVEY CONTROL ORDER

Horizontal	_____
Vertical	_____

WISCONSIN COORDINATE SYSTEM

Corner	East (X)	North (Y)	Elevation (Z)	Zone
Control Sta. Name				

~~City, Village or~~ Village of Ontario
County of Vernon
Wisconsin