


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

**SECTION 30, T19N, R3W, TOWN OF NEW LYME
MONROE COUNTY, WISCONSIN**

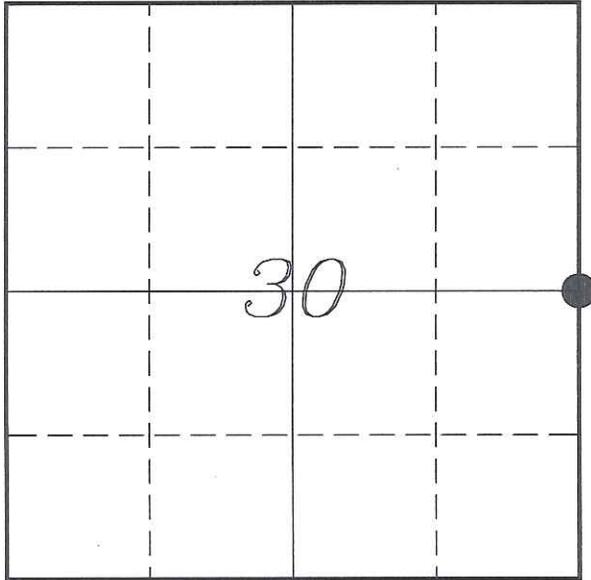

| | |
|---------------------------------|-----------------|
| MONROE COUNTY COORDINATE SYSTEM | |
| Northing | 434030.287 |
| Easting | 636427.363 |
| Datum | NAD 1983 (1991) |
| Elevation | |
| Datum | |
| TYPE OF LANDMARK: | |
| Set Harrison Monument | |
| BEARINGS ARE REFERENCED TO: | |
| Monroe County Coordinates | |

LOCATION OF LANDMARK

Witnesses: Laurence E Johns III
Al Hoff

Date: 6 April 2014

Describe any record evidence, monument evidence, testimonial evidence or any other material evidence you considered and whether the monument was found or restored through acceptance of an obliterated evidence location.

No bearing trees of record were located.

I did a general search of an area to the North and did not find Keach's buggy axel.

I found a survey nail next to a marked metal fence post, along with a rotten lath, at the computed mid-point between the NE & SE Corners.

It is not clear where the nail came from, but it appears to have been set by a surveyor at the mid-point and that property owners have recognized it as the corner.

I accepted the nail located at the mid-point as the best available evidence of the original government corner and replaced it with a Harrison Monument.

Describe or show any material discrepancy between the location of the restored corner and that of the corner previously restored or re-established.

John Dunn established this corner in November 1846.

C M Keach was at this corner, in March 1904, during a survey in Section 29. He shows that he found the stumps of the government bearing trees and set an Buggy Axel at this corner.


Notes in this office indicate there is a section breakdown of Section 29, performed by Lawrence Feddersen, in 1979. This breakdown shows this corner at the mid-point between corners.

Gary Dechant may have been at this corner, in September 1987, during a survey in Section 29. He shows that he set the '40' Corner to the North and would have needed this corner to do that.

Ronald Parish may have been at this corner, in July 1993, during a survey in Section 30. He shows that he set the Center of Section and would have needed this corner to do that.

RECORD OF DURABLE WITNESS MONUMENTS


| NO | DESCRIPTION | BEARING | DISTANCE |
|----|---|---------------|----------|
| 1 | Set 3/4" x 18" Iron Rod 8' North of a 15" White Pine | N 24°03'02" W | 51.16' |
| 2 | Set 3/4" x 18" Iron Rod 12' West of a 20" White Pine | N 60°46'18" E | 69.84' |
| 3 | Set 3/4" x 18" Iron Rod 9' West of a 8" Jack Pine | S 65°20'21" E | 93.30' |
| 4 | Set 3/4" x 18" Iron Rod 9' East of a 15" Red Oak | S 75°31'27" W | 67.84' |

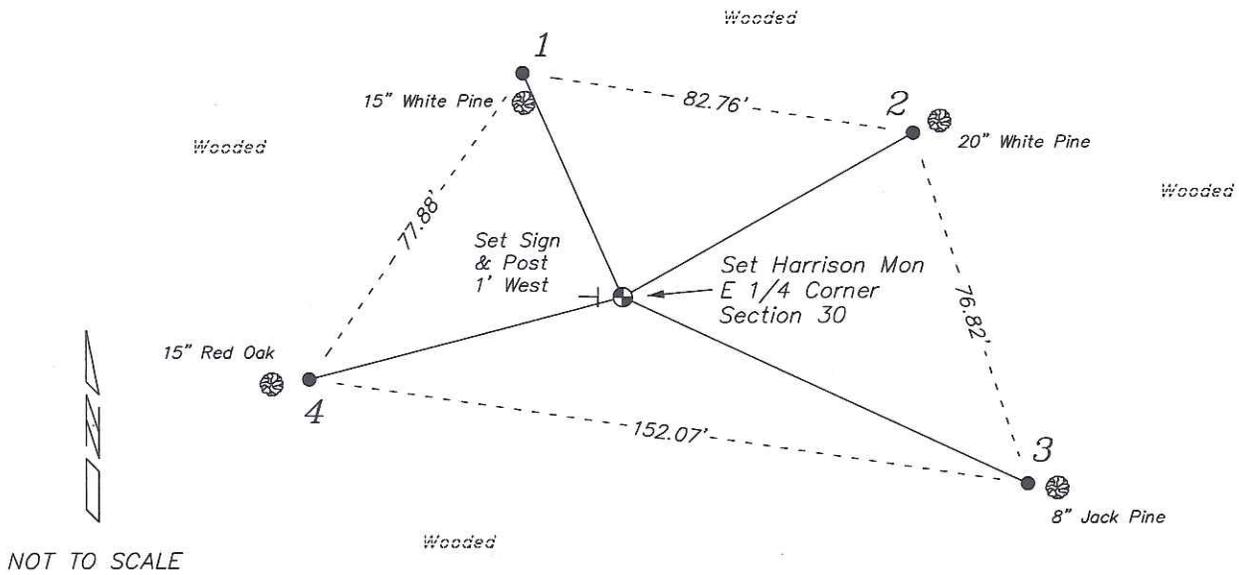

PLAN VIEW DRAWING OF REFERENCE TIES

Map Showing Distance And Direction To Other Public Land Survey
Corners Used For Re-Establishing The Corner

LAURENCE E. JOHNS III
 S-2804
 WILTON, WISCONSIN
 LAND SURVEYOR
Laurence E. Johns III
 7 APR 14

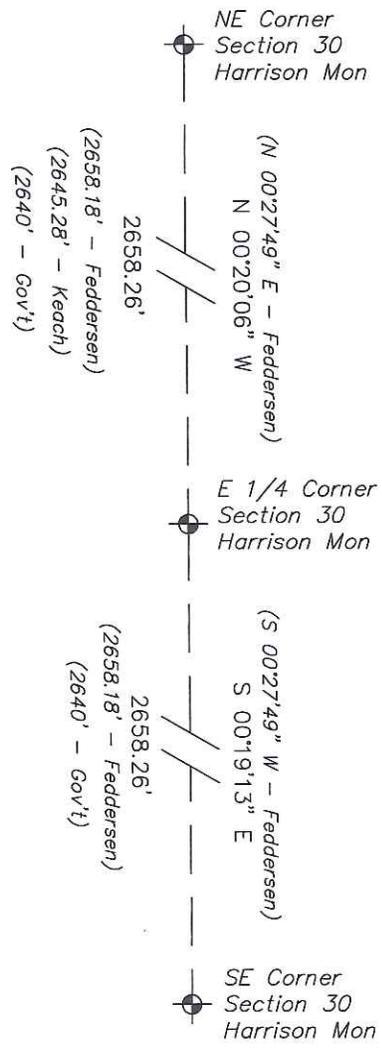

I, Laurence E Johns III RLS 2804, Registered Land Surveyor, hereby certify that the corner location shown on this record was determined by me or under my direction and control, and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Laurence E Johns III RLS 2804
Eagle Ridge Surveying
 PO Box 213
 Wilton, Wisconsin
 7 April 2014