

2 20 03 3/0000

Government Land Corner Certificate

Jackson County

CORNER NO. _____

SECTION 31

TOWN 20N

RANGE 3W

TYPE OF MONUMENT: 2" BRASS CAP PIPE

STATE PLANE COORDINATES: N 47663.5611

WISCRS NAD83(91)

E 107243.0585

12/21/2015

ELEVATION — M.S.L. DATUM: _____

Ethan Remus

THETA ANGLE: _____

FIELD BOOK: _____ PAGE _____

DRAWN BY: D.W. MELICHAR



LOCATION (Indicated by 'X')

BASIS FOR MONUMENT LOCATION Ref.- CSM #383

Show info such as: History of corner, with reference to Vol. and pg., dates, surveyor; exact description of monument replaced; if location computed, by taped or EDM traverse; landowner remarks, etc. (Use reverse side if necessary)

SEAL:



County Surveyor C.M. Keach, in County Survey Record No. 397 made in 1902 and recorded in Vol. 2 at page 142 states, "Found one W Pine stump - set stone 20 x 10 x 4"

Keith H. Bennett, in a survey for Jackson Co. Forestry Dept. made in 1941 and recorded in Vol. 14 at p.15, states, "Iron pipe in mound with stone from former survey."

This corner is in very swampy ground. We found that a corner fence post had been set on the west side of the brass cap pipe and wire fence had been stretched east, tipping the post considerably in that direction. Fortunately the monuments at the 1/16 and 1/4 corners North were undisturbed, so we projected the section line over them to the section corner for control of its East-West position. After digging out the stone and removing pipe we reset pipe in proper location. To help stabilize the pipe we carried in about 30 gallons of sand to refill the hole and raise the mound a little.


DATA SHOWN HERE ON CERTIFIED CORRECT:

Ray W. Hurlburt
Registered Land Surveyor

DATE: Feb. 24, 1981

TIE SKETCH SCALE 1"=30'

Show at least four ties, also fence lines, roads, topo, size and type of witness trees and if off road - best way to arrive at corner.

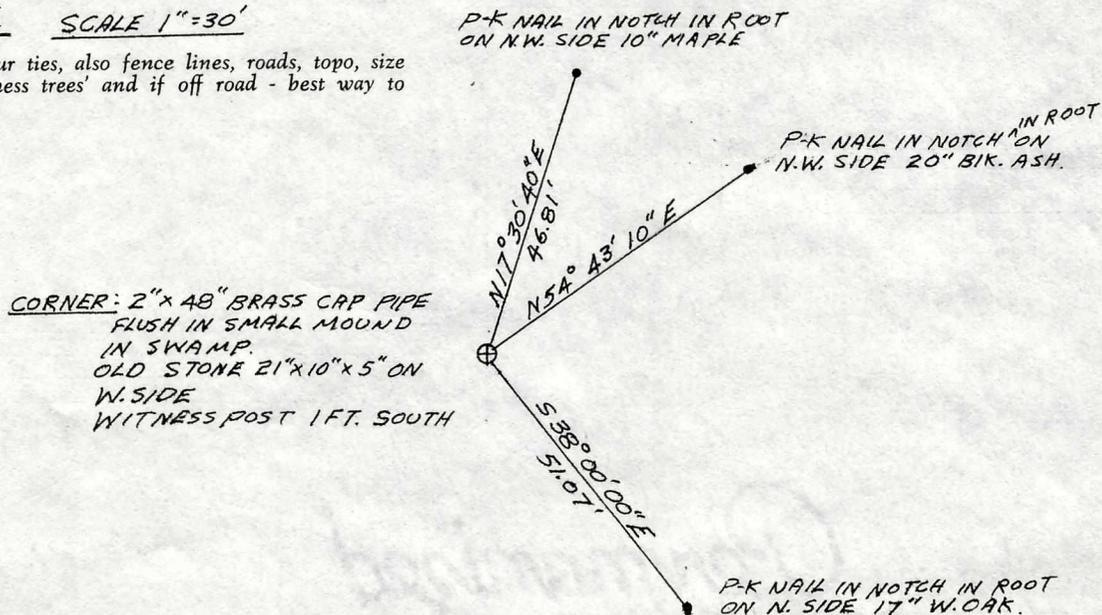

CORNER: 2" x 48" BRASS CAP PIPE
FLUSH IN SMALL MOUND
IN SWAMP.
OLD STONE 21" x 10" x 5" ON
W. SIDE
WITNESS POST 1 FT. SOUTH

Government Land Corner Certificate

Jackson County

TYPE OF MONUMENT: 2" BRASS CAP PIPE

STATE PLANE COORDINATES: N _____
E _____

ELEVATION — M.S.L. DATUM: _____

THETA ANGLE: _____

FIELD BOOK: _____ PAGE _____


DRAWN BY: D.W. MELIGAR

CORNER NO. _____

SECTION 31

TOWN 20N

RANGE 3W

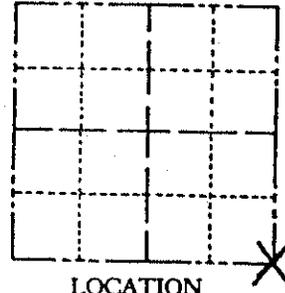

LOCATION
(Indicated by 'X')

BASIS FOR MONUMENT LOCATION Ref.- CSM #383'

Show info such as: History of corner, with reference to Vol. and pg., dates, surveyor; exact description of monument replaced; if location computed, by taped or EDM traverse; landowner remarks, etc. (Use reverse side if necessary)

County Surveyor C.M. Keach, in County Survey Record No. 397 made in 1902 and recorded in Vol. 2 at page 142 states, "Found one W Pine stump - set stone 20 x 10 x 4"

Keith H. Bennett, in a survey for Jackson Co. Forestry Dept. made in 1941 and recorded in Vol. 14 at p.15, states, "Iron pipe in mound with stone from former survey."

This corner is in very swampy ground. We found that a corner fence post had been set on the west side of the brass cap pipe and wire fence had been stretched east, tipping the post considerably in that direction. Fortunately the monuments at the 1/16 and 1/4 corners North were undisturbed, so we projected the section line over them to the section corner for control of its East-West position. After digging out the stone and removing pipe we reset pipe in proper location. To help stabilize the pipe we carried in about 30 gallons of sand to refill the hole and raise the mound a little.

SEAL:



DATA SHOWN HERE ON
CERTIFIED CORRECT:

Ray W. Hurlburt
Registered Land Surveyor

DATE: Feb. 24, 1981

TIE SKETCH

SCALE 1"=30'

Show at least four ties, also fence lines, roads, topo, size and type of witness trees and if off road - best way to arrive at corner.

