

69

**U.S. PUBLIC LAND CORNER
MAINTENANCE**


Corner ID : SE Sec.17, T18N-R1E

41801170000

| <u>DATE</u> | <u>CREW</u> | <u>MONUMENT TYPE</u> ----- |
|--------------------|---|--|
| September 16, 2015 | Zachariah P. Dechant Gary L. Dechant | Existing 1 1/4" iron pipe in concrete in north-south fence. 109' south of center line STH "21" / Main Street intersection Set survey sign 1' east. I had replaced destroyed Harrison in an earlier survey with the 1 1/4" pipe and concrete. |

References:

| | <u>Bearing</u> | <u>Distance</u> |
|---|----------------|-----------------|
| 1) Set 3/4"x24" round iron bar, down 6", 5' SW 12" Jack Pine | N70E | 25.98' |
| 2) Set 3/4"x24" round iron bar, down 6" | S39E | 18.98' |
| 3) Set 3/4"x24" round iron bar, down 6", 5' NE 14" White Pine | S36W | 30.14' |
| 4) Set 3/4"x24" round iron bar, down 6", 5' north 8" Oak | N64W | 31.12' |

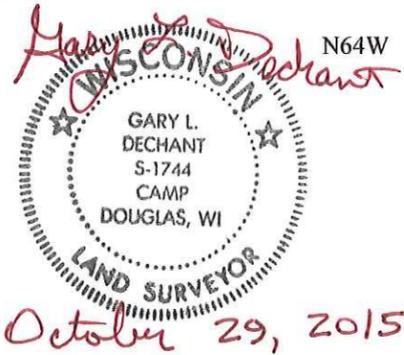Gary L. Dechant

October 29, 2015

U.S. PUBLIC LAND SURVEY MONUMENT RECORD MONROE COUNTY, WISCONSIN.

IN ACCORDANCE WITH WISCONSIN ADMINISTRATIVE CODE, CHAPTER A-E 7.08 (3) (A) - (I)

LOCATION: (A) THE IDENTITY OF THE CORNER, AS REFERENCED TO THE U.S. PUBLIC LAND SURVEY SYSTEM.

SECTION 17 - TOWN 18N - RANGE 1E

TOWNSHIP OF BYRON


TYPE OF CORNER SE CORNER

TYPE OF MONUMENT 1" IRON PIPE


HORIZONTAL DATUM MONROE CO. COORDINATES

NORTHING / LATITUDE 410,434.23

EASTING / LONGITUDE 736,436.70

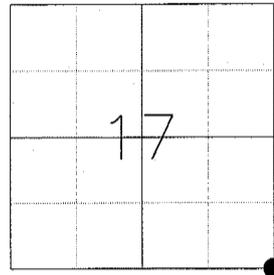

PLAN VIEW: (C) REFERENCE TO AT LEAST 4 WITNESS MONUMENTS. WITNESS MONUMENTS SHALL BE CONCRETE, NATURAL STONE, IRON, BEARING TREES OR OTHER EQUALLY DURABLE MATERIAL, EXCEPT WOOD OTHER THAN BEARING TREES; (D) A PLAN VIEW DEPICTING THE RELEVANT MONUMENTS AND REFERENCE TIES WHICH ARE SUFFICIENT IN DETAIL TO ENABLE ACCURATE RELOCATION OF THE CORNER MONUMENT IF THE CORNER MONUMENT IS DISTURBED; (E) A DESCRIPTION OF ANY MATERIAL DISCREPANCY BETWEEN THE LOCATION OF THE CORNER AS RESTORED OR REESTABLISHED AND THE LOCATION OF THAT CORNER AS PREVIOUSLY RESTORED OR REESTABLISHED;

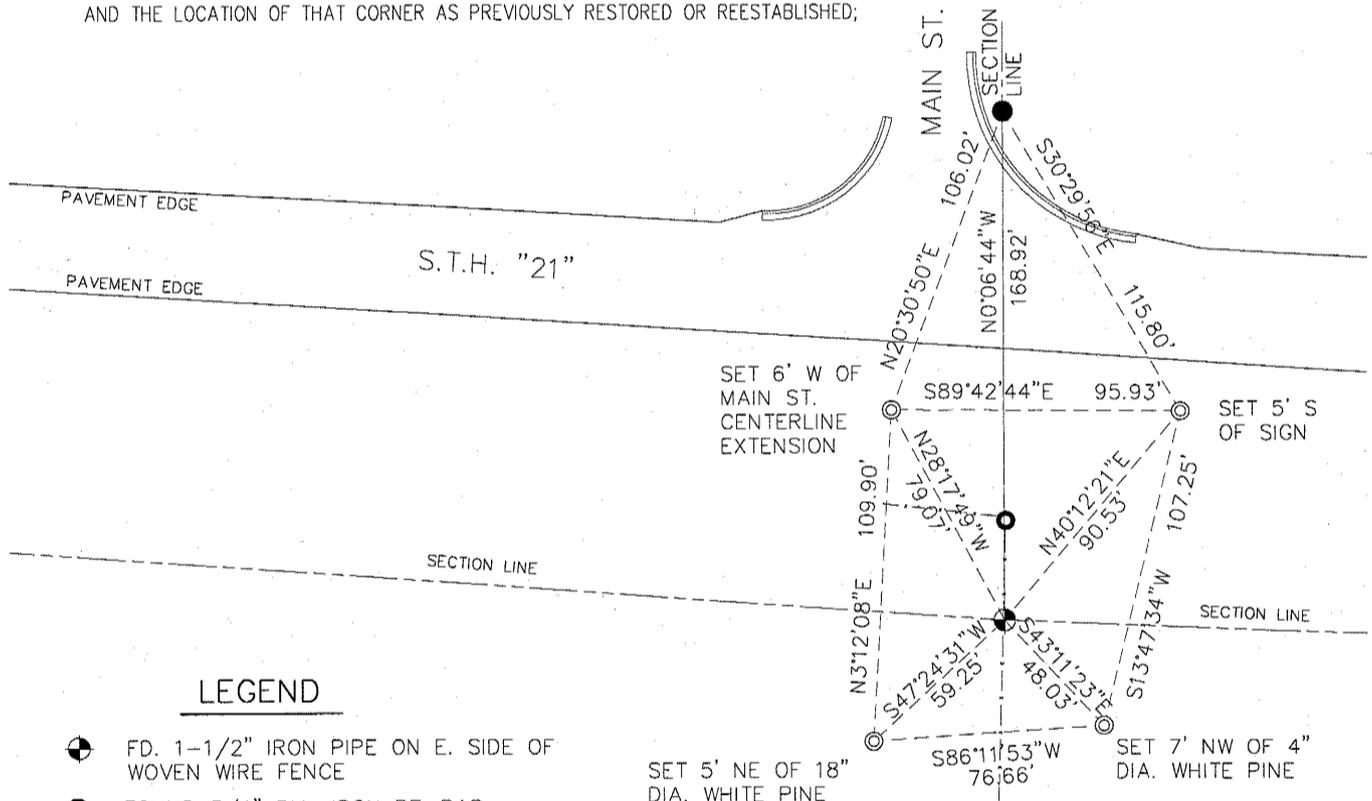

LEGEND

- FD. 1-1/2" IRON PIPE ON E. SIDE OF WOVEN WIRE FENCE
- FOUND 3/4" DIA. IRON RE-BAR
- ⊙ SET 3/4" DIA. X 24" IRON RE-BAR, 1.50 LBS./LIN.FT.
- EXISTING YELLOW R/W POST

SET 5' NE OF 18" DIA. WHITE PINE

SET 7' NW OF 4" DIA. WHITE PINE

SURVEYOR'S CERTIFICATE: CHAPTER 7.08 (3) (I)

THE UNDERSIGNED HEREBY CERTIFIES THAT THE U.S. PUBLIC LAND SURVEY MONUMENT RECORD SHOWN WAS DETERMINED BY THEM OR UNDER THEIR DIRECTION AND IS CORRECT TO THE BEST OF THEIR KNOWLEDGE AND BELIEF.



Mark T. Krizan
WISCONSIN REGISTERED LAND SURVEYOR

2-10-11
DATE CERTIFIED

U.S. PUBLIC LAND SURVEY MONUMENT RECORD MONROE COUNTY, WISCONSIN.

IN ACCORDANCE WITH WISCONSIN ADMINISTRATIVE CODE, CHAPTER A-E 7.08 (3) (A) - (I)

RECOVERY PROCEDURES:

(B) A DESCRIPTION OF ANY RECORD EVIDENCE, MONUMENT EVIDENCE, OCCUPATIONAL EVIDENCE, TESTIMONIAL EVIDENCE OR ANY OTHER MATERIAL EVIDENCE CONSIDERED BY THE SURVEYOR, AND WHETHER THE MONUMENT WAS FOUND OR PLACED;

FOUND 1-1/2" IRON PIPE AT THE LOCATION SHOWN ON MONUMENT RECORD SHEET BY HARLEY A. SIME, DATED JANUARY 20, 1981. SAID RECORD SHEET STATES, "REPLACED IRON PIPE WITH HARRISON", BUT NO HARRISON WAS FOUND. NO TIES WERE FOUND, SO I SET 4 NEW TIES AND USED A FOUND ROD FOR A FIFTH TIE, AS SHOWN.

(F) WHETHER THE CORNER WAS RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED EVIDENCE LOCATION OR A FOUND PERPETUATED LOCATION;


FOUND PERPETUATED LOCATION

(G) WHETHER THE CORNER WAS REESTABLISHED THROUGH LOST-CORNER PROPORTIONATE METHODS;

NO

(H) THE DIRECTIONS AND DISTANCES TO OTHER PUBLIC LAND SURVEY CORNERS WHICH WERE USED AS EVIDENCE OR USED FOR PROPORTIONING IN DETERMINING THE CORNER LOCATION;

THE COURSES BETWEEN THE SECTION CORNER MONUMENTS ARE SHOWN AS A COURTESY. THEY WERE NOT USED TO SET THE CORNER, SINCE IT'S A FOUND MONUMENT.

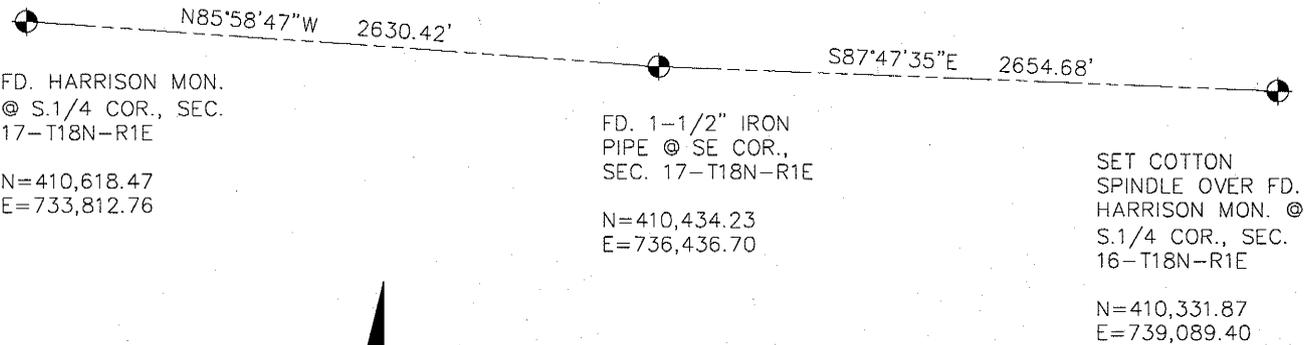

SURVEYOR'S CERTIFICATE: CHAPTER 7.08 (3) (I)

THE UNDERSIGNED HEREBY CERTIFIES THAT THE U.S. PUBLIC LAND SURVEY MONUMENT RECORD SHOWN WAS DETERMINED BY THEM OR UNDER THEIR DIRECTION AND IS CORRECT TO THE BEST OF THEIR KNOWLEDGE AND BELIEF.



Mark T. Krizan
WISCONSIN REGISTERED LAND SURVEYOR

2-10-11
DATE CERTIFIED

I, Harley A. Sime, do hereby certify that on the 27th day of March 1980, I found (evidence) (~~no evidence~~) of the NW corner of Section 21, T 18 N, R 1 E Fourth Principal Meridian, and I re-established said corner according to the Wisconsin Statutes as shown and described hereon.

Dated this 20th day of Jan. 1981.

Harley A. Sime, R.L.S. 355

 County Surveyor
Title

History of corner establishment since Original Government Survey

Fred Zietlow set an iron pipe here in October of 1969.

Description of corner evidence found:

Found the iron pipe and replaced it with a Harrison Monument.




**See Reverse Side
For Maintenance**

COUNTY SURVEYOR FORM NO. 1

Description of corner and witness monuments, references and accessories used to perpetuate the original or re-established location of this corner:

Witnesses to corner location:

M. Scott Sowers
C. Pietz
W.C. Jung *William C. Jung*

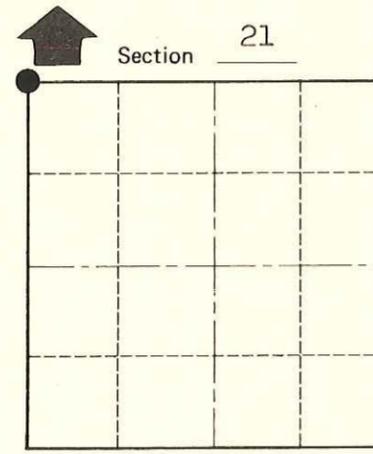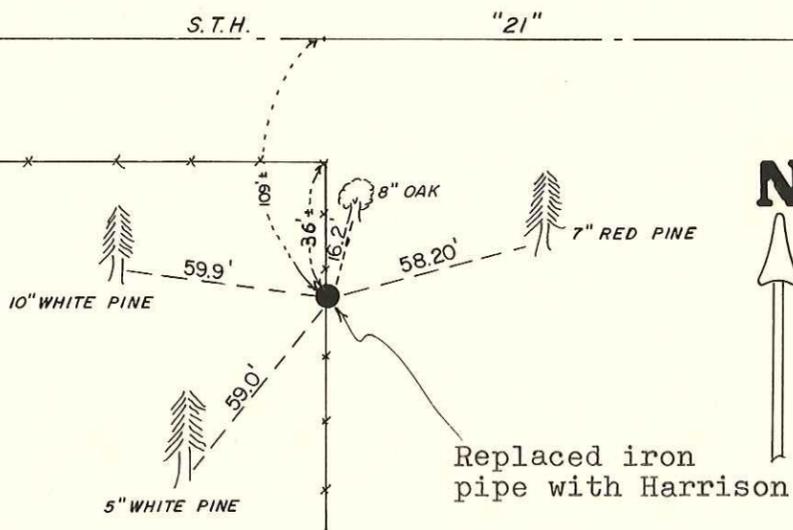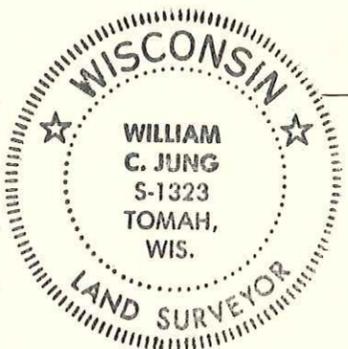

● = LOCATION CORNER

T 18 N R 1 E

**Approved: HARLEY A. SIME
MONROE CO. SURVEYOR**

SURVEY CONTROL ORDER

| | |
|------------|-------|
| Horizontal | _____ |
| Vertical | _____ |

WISCONSIN COORDINATE SYSTEM

| Corner | East (X) | North (Y) | Elevation (Z) | Zone |
|-------------------|----------|-----------|---------------|------|
| Control Sta. Name | | | | |

(All trees are double blazed with N&C's set)

WISCONSIN
**PLACED
 COUNTY SURVEYOR'S
 SIGN 6-12-87**

~~City, Village~~ or Town Byron
 County of Monroe