

CERTIFICATE

I, Nicholas M. Hillmer, do hereby certify that this document and the data contained herein was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the State of Wisconsin.

Dated this 23rd day of May, 2013



Nicholas M. Hillmer, P.L.S. 2909
Anderson Engineering of Minnesota, LLC.

CERTIFIED LAND CORNER

History of corner established since Original Government Survey

Fred Holden was here in 1905 and set a 1 1/2 inch angle iron. Harley Sime found and accepted the angle iron and replaced it with a Harrison monument in 1981.

Description of evidence found

On January 22nd, 2013, Anderson Engineering of Minnesota located the Harrison monument just below grade in the center of an east-west bituminous road.

No. 21703320020



Description of corner and witness monuments, references and accessories used to perpetuate the original or re-established location of this corner:



Witnesses to corner location:

Nick Hillmer
Josh Oslund
Dan Greenwald

MONROE COUNTY
COORDINATE SYSTEM
NAD 1983 (2007)

HARRISON MONUMENT
Northing (Y) 363253.13
Easting (X) 639791.70

Base Station - 22 182W
Northing (Y) 408053.25
Easting (X) 679287.00

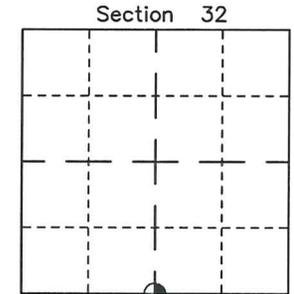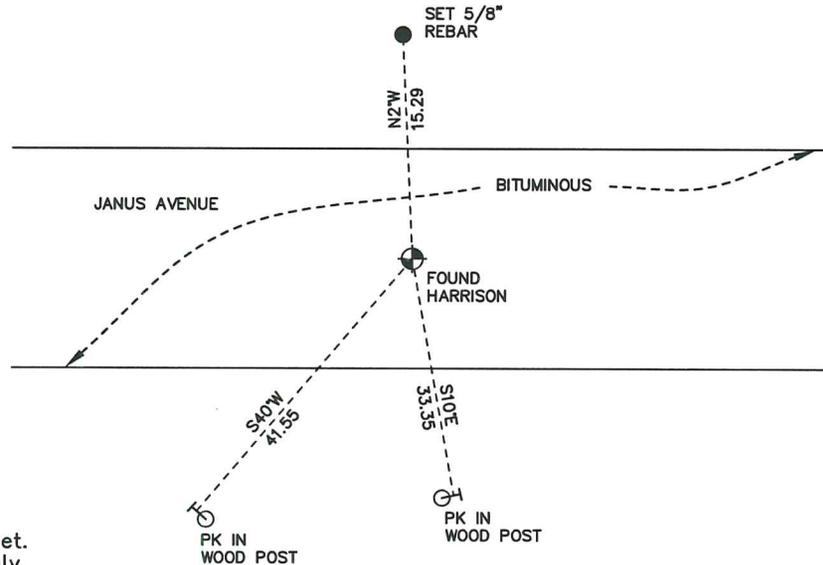

● = LOCATION CORNER
Corner I.D. S 1/4 32
T 17 N R 3 W
Town of Angelo
Monroe County, WI.

All distances are shown in U.S. Survey Feet.
Bearings are for tie reference purposes only.
Coordinates were derived from RTK GNSS procedures.

21703320020

I, Harley A. Sime do hereby
certify that on the twenty-second day
of May 1981, I found
(evidence) ~~no evidence~~ of the South 1/4
corner of Section 32, T 17 N,
R 3 W Fourth Principal Meridian, and I re-
established said corner according to the Wisconsin
Statutes as shown and described hereon.

Dated this 27th day of Aug. 1981.

Harley A. Sime

Monroe County Surveyor


History of corner establishment since Original Government Survey

Fred Holden was here in February of 1905 and set a
1 1/2" angle iron at the corner.
A.B.Holden was here in the 1870's
Schroeder set temp. corner here in Sept. 1890

Description of corner evidence found:

Found Holdens angle iron in road. Drove angle iron
down and set Harrison monument over it.

1998 UPDATE: Norb Smith, Monroe County Highway Commissioner called the County Surveyor's
Office and informed us that the Town Road running along the South line of Sections 32
and 33 West of STH "71" would be milled. Set reference ties and removed Harrison. After
road work was completed we set a 21" long Harrison marker, down 1/2" below surface of road.
Established new ties as shown below.

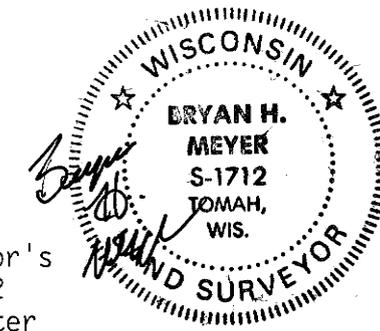

Approved: **HARLEY A. SIME**

MONROE CO. SURVEYOR


Description of corner and witness monuments, references and accessories used to perpetuate the original or re-established location of this corner:

Witnesses to corner location:

Bryan H. Meyer - Crew Chief


Gary L. Dechant

Carlton R. Pietz

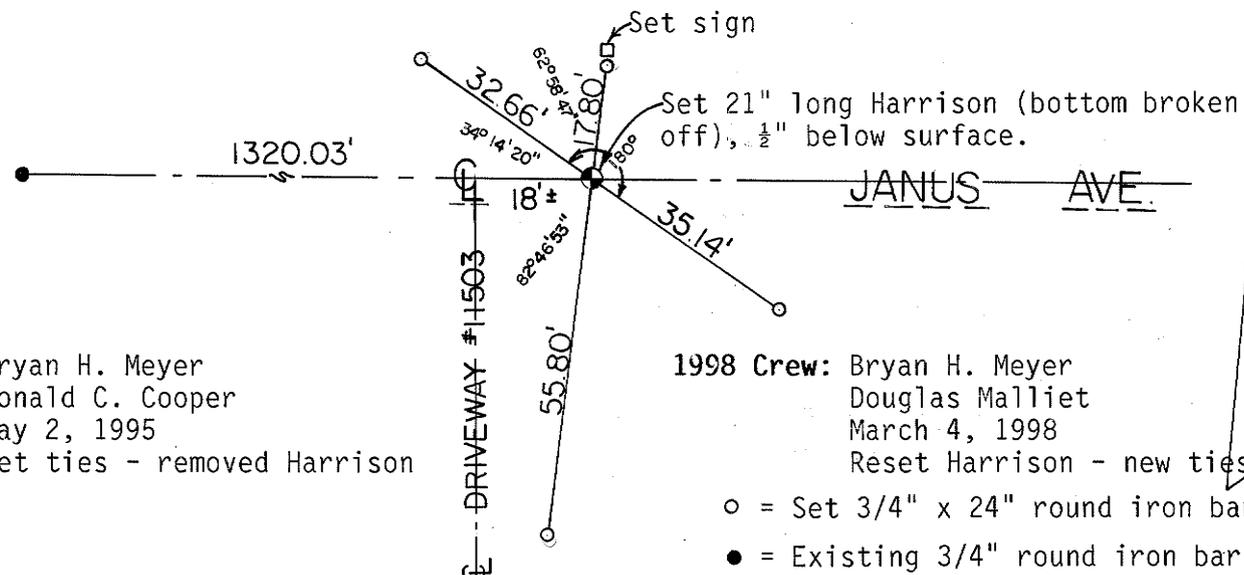

1995 CREW: Bryan H. Meyer
Donald C. Cooper
May 2, 1995
Set ties - removed Harrison

1998 Crew: Bryan H. Meyer
Douglas Malliet
March 4, 1998
Reset Harrison - new ties
o = Set 3/4" x 24" round iron bar
● = Existing 3/4" round iron bar

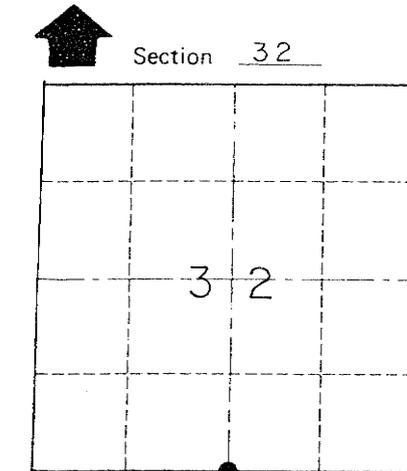

Section 32
T 17 N R 3 W

SURVEY CONTROL ORDER

Horizontal	_____
Vertical	_____

WISCONSIN COORDINATE SYSTEM

Corner	East (X)	North (Y)	Elevation (Z)	Zone
Control Sta. Name				

~~City, Village or~~ Town of Angelo

County of Monroe

Reference file number 3043

Bryan H. Meyer
H. A. Sime and Associates
P. O. Box 50
Tomah, Wisconsin 54660

COUNTY SURVEYOR FORM NO. 1