
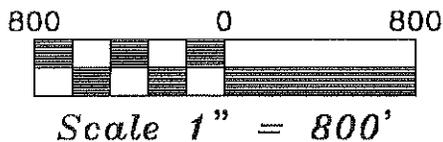



# MAP OF SURVEY

LOCATED IN THE FRAC. SW1/4-NW1/4, FRAC. NW1/4-SW1/4 AND NE1/4-SW1/4 OF SECTION 7, T19N-R1E, TOWN OF SCOTT, AND THE SE1/4-NE1/4 OF SECTION 12, T19N-R1W, TOWN OF LINCOLN, MONROE COUNTY, WISCONSIN.

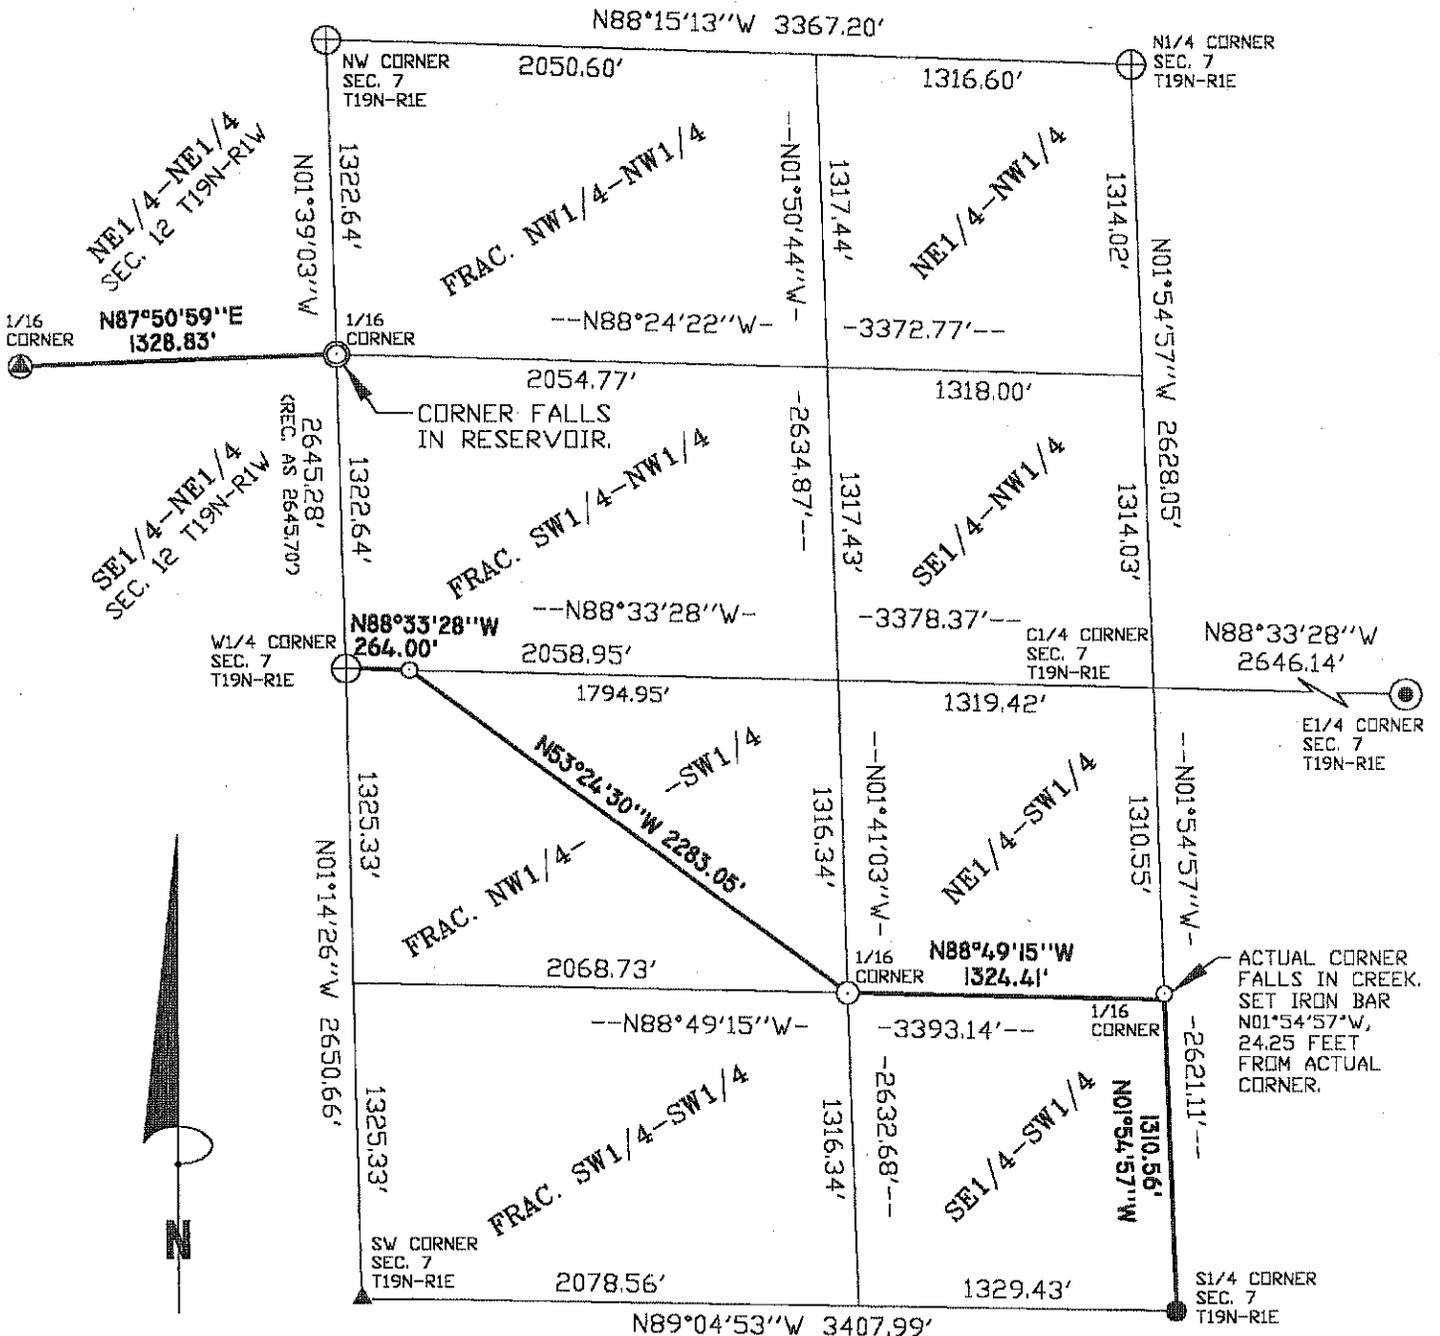

BEARINGS ARE REFERENCED TO THE NORTH-SOUTH QUARTER LINE OF SECTION 7, ASSUMED TO BEAR N01°54'57"W.

- ⊙ = SET 1-5/8" O.D. X 11' IRON PIPE WEIGHING 2.27 LBS./LIN. FT.
- = SET 1-5/16" O.D. X 60" IRON PIPE WEIGHING 1.68 LBS./LIN. FT.
- ◊ = SET 3/4" X 24" ROUND IRON BAR WEIGHING 1.50 LBS./LIN. FT.
- = EXISTING 1-1/4" ROUND IRON BAR.
- ⊕ = EXISTING 1-5/8" O.D. IRON PIPE.
- ▲ = EXISTING MAG MASONRY NAIL.
- ⊕ = EXISTING 3-1/2" O.D. IRON PIPE.
- ⊙ = EXISTING CAST IRON HARRISON MONUMENT.

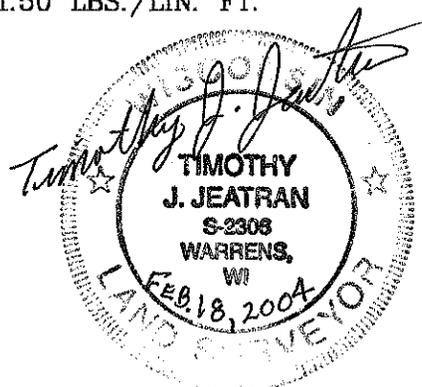

FILE NO. 250-P  
FEBRUARY 18, 2004

PAGE 1 OF 2

CSR 1802

NOTE: On May 18, 1989, Bryan H. Meyer of H.A. Sime and Associates, set a 1-1/4" x 72" capped iron pipe at the C1/16 SW corner of Section 7, T19N-R1W. When I subdivided Section 7 my computed location for the C1/16 SW corner of Section 7 was N05°27'03"E 3.24 feet from Bryan Meyer's Iron pipe. I talked with Gary Sime of H.A. Sime and Associates and he looked at their survey notes and found that there must have been an error in measurements to the S1/4 corner of Section 7. I set a new iron pipe at my computed location.

#### SURVEYOR'S CERTIFICATE:

I, Timothy J. Jeatran, being a duly qualified Surveyor do hereby certify that by the order and under the direction of Jack Potter, I have surveyed and mapped the North line of the Southeast Quarter of the Northeast Quarter (SE1/4-NE1/4) of Section 12, T19N-R1W, Town of Lincoln and also a line located in the Southeast Quarter of the Southwest Quarter (SE1/4-SW1/4) and Fractional Northwest Quarter of the Southwest Quarter (Frac. NW1/4-SW1/4) of Section 7, T19N-R1E, Town of Scott, described as follows: Beginning at the South Quarter (S1/4) corner of said Section 7; thence N01°54'57"W, 1310.56 feet to the Northeast corner of said SE1/4-SW1/4; thence N88°49'15"W, 1324.41 feet to the Northwest corner of said SE1/4-SW1/4; thence N53°24'30"W, 2283.05 feet to the North line of said Frac. NW1/4-SW1/4; thence N88°33'28"W, 264.00 feet to the West Quarter (W1/4) corner of said Section 7 and the end of this line; all in Monroe County, Wisconsin. I further certify that the within map is a true and correct representation of the land surveyed and that I have fully complied with the provisions of Chapter AE-7 of the Wisconsin Administrative Code to the best of my knowledge and belief.

*Timothy J. Jeatran*

TIMOTHY J. JEATRAN, Registered Land Surveyor, S-2306  
JEATRAN SURVEYING & SOIL TESTING, INC.  
20844 Aspen Avenue  
Warrens, Wisconsin 54666  
(608) 378-4091

