

VERNON COUNTY CERTIFIED U.S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: THIS RECORD SHALL SHOW THE LOCATION OF THE CORNER AND SHALL INCLUDE ALL OF THE FOLLOWING ELEMENTS (A-I)

(A) IDENTIFY THE CORNER BY REFERENCE TO THE U.S. PUBLIC LAND SURVEY SYSTEM

■ = CORNER MONUMENT RESTORED

WITNESSES TO CORNER LOCATION:

- 1) Robert M. Lampman
- 2) Jessica A. Zamor

VERNON COUNTY COORDINATES - NAD83(1991) - SURVEY FEET


NORTHING: 213140.680

EASTING: 851913.749

MONROE COUNTY COORDINATES - NAD83(1991) - SURVEY FEET

NORTHING: 302087.585

EASTING: 755466.704

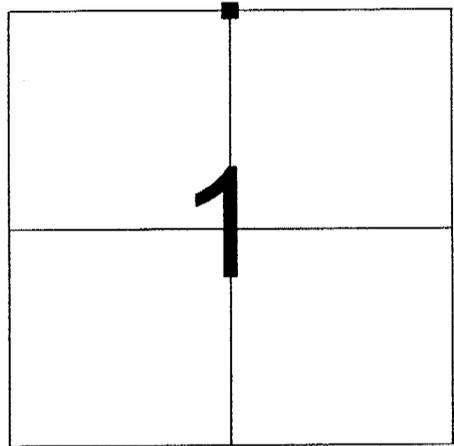

SECTION 1
TOWN 14 NORTH, RANGE 1 EAST

(B) DESCRIBE ANY RECORD EVIDENCE, MONUMENT EVIDENCE, OCCUPATIONAL EVIDENCE, TESTIMONIAL EVIDENCE OR ANY OTHER MATERIAL EVIDENCE YOU CONSIDERED, AND WHETHER THE MONUMENT WAS FOUND OR PLACED.


Accepted location of existing True Cast Products Monument at occupied fence corner.

East/west location of the corner was found to agree well with occupied forty corners and recorded distances to the east and west. North/south location agrees well with overall average bearing of the township line, a strong occupied line running east to township corner and occupation at this corner area. Occupation at the forty corner to the west of this monument was found to be north of the section line by approximately 23 feet.

(See reverse side for corner history.)

(C) IN THE PLAN VIEW DRAWING BELOW, PROVIDE REFERENCE TIES TO AT LEAST 4 WITNESS MONUMENTS OR, IF THE LOCATION IS WITHIN A MUNICIPALITY, TO AT LEAST 2 WITNESS MONUMENTS. (WITNESS MONUMENTS SHALL BE MADE OF CONCRETE, NATURAL STONE, IRON, OR OTHER EQUALLY DURABLE MATERIAL.) DESCRIBE WITNESS MONUMENTS.

(D) SHOW A PLAN VIEW DRAWING, DEPICTING THE RELEVANT MONUMENTS AND REFERENCE TIES, WHICH IS SUFFICIENTLY DETAILED TO ENABLE ACCURATE RELOCATION OF THE CORNER MONUMENT IF IT IS DISTURBED.

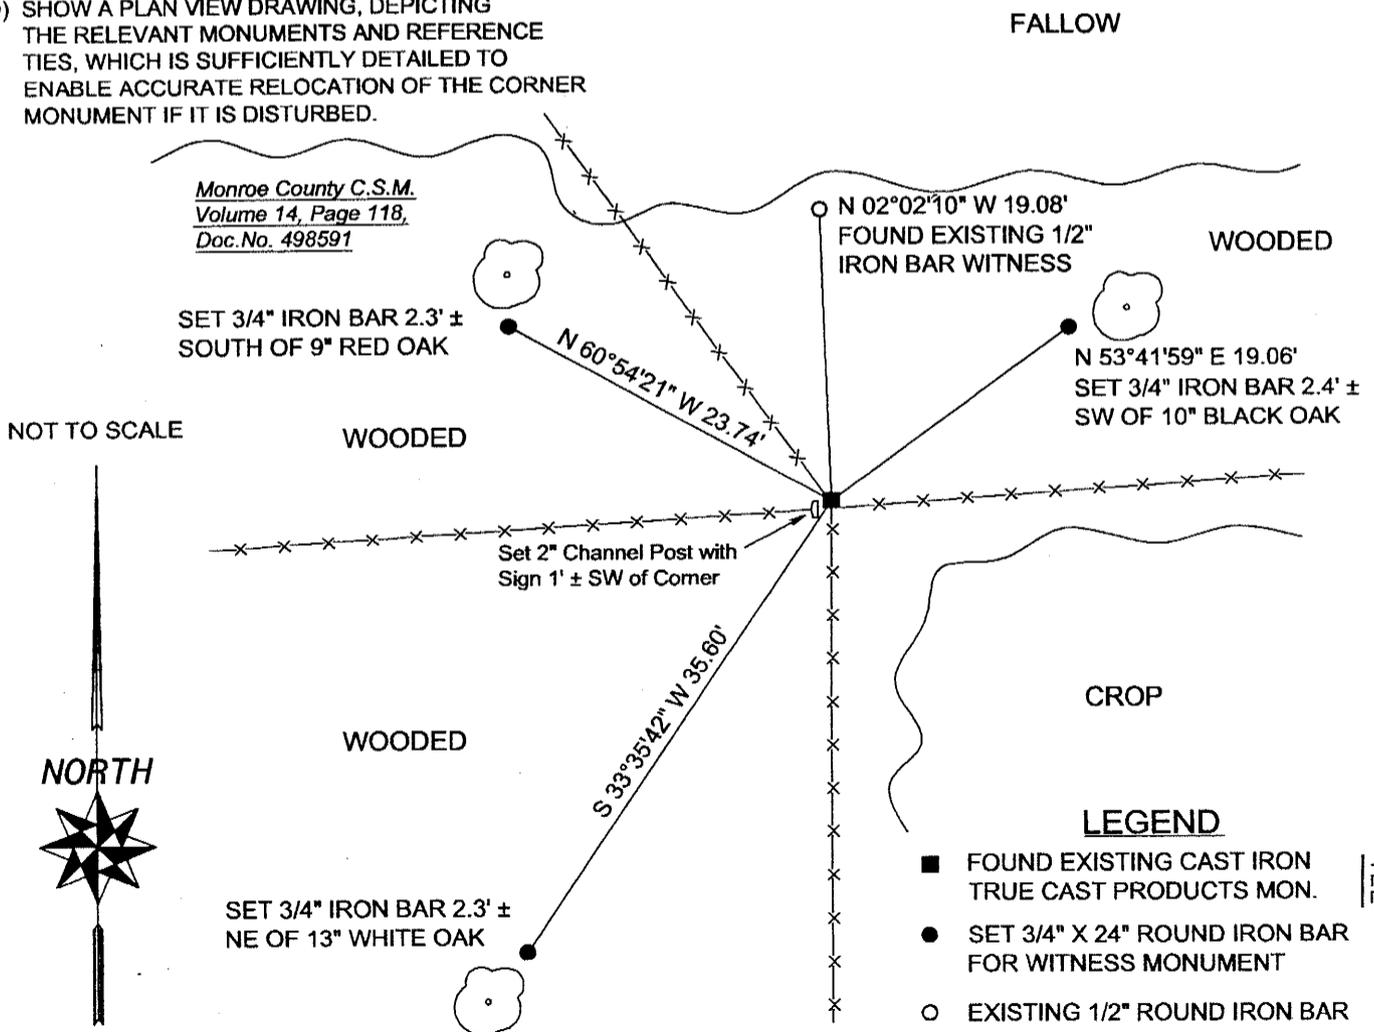

(E) DESCRIBE ANY MATERIAL DISCREPANCY BETWEEN THE LOCATION OF THE CORNER AS RESTORED OR REESTABLISHED AND THE LOCATION OF THAT CORNER AS PREVIOUSLY RESTORED OR REESTABLISHED BY DISTANCE AND DIRECTION. SHOW THE DISCREPANCY ON THE PLAN VIEW DRAWING UNDER (D), ABOVE. SHOW THE DISTANCES BETWEEN THE CORNER AS PREVIOUSLY RESTORED OR REESTABLISHED AND (1) THE CORNER AS RESTORED OR REESTABLISHED, AND (2) TO AT LEAST 2 OF THE WITNESS MONUMENTS AS SHOWN ON THE DRAWING IN (D), ABOVE.

N/A

(F) WAS THE CORNER RESTORED THROUGH ACCEPTANCE OF (1) AN OBLITERATED EVIDENCE LOCATION, OR (2) A FOUND PERPETUATED LOCATION?

(2) A FOUND PERPETUATED LOCATION

(G & H) WAS THE CORNER REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS? IF SO SHOW THE METHOD, INCLUDING THE DIRECTIONS AND DISTANCES TO OTHER PUBLIC LAND SURVEY CORNERS USED AS EVIDENCE OR USED FOR PROPORTIONING IN DETERMINING THE CORNER LOCATION.

N/A

(**) ANY ADDITIONAL INFORMATION RELATED TO CORNER LOCATION

CORNER HISTORY:

-Original government corner location established by Stuntz & Sargent in 1851.

-Gary Dechant set a cast iron Monroe County monument at the corner and prepared a tie sheet dated December 31, 1996. Gary Dechant established the corner location through acceptance of occupation.

-In Decemember of 1998, Carl M. Sandsness prepared an updated tie sheet for the corner with new witnesses.

-Richard T. Blakeslee shows a Monroe County iron monument found at the corner on Monroe County C.S.M. Volume 11, Page 141. Said C.S.M. being dated August 3, 1997.

-Richard T. Blakeslee shows an existing Harrison Monument at the corner on Monroe County C.S.M. Volume 14, Page 118. Said C.S.M. being dated June 29, 2001.


-Richard T. Blakeslee shows an existing Harrison cast iron monument at the corner on Monroe County C.S.M. Volume 16, Page 121. Said C.S.M. being dated May 9, 2003.

AFFIX LAND SURVEYOR SEAL

(I) I, ROBERT M. LAMPMAN, CERTIFY THAT THE LOCATION SHOWN ON THIS RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.


SIGNATURE

3-10-04
DATE

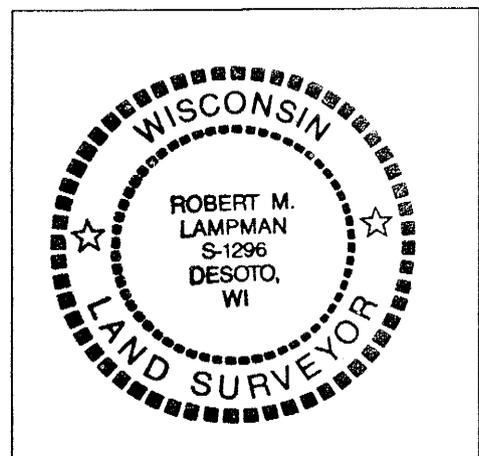

FOR VERNON COUNTY, WISCONSIN

41501360020


Note: This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter AE-7.08, U.S. Public Land Survey Monument Record (3)(a)(b)(c)(d)(e)(f)(g)(h)(i). Use additional sheets if necessary.

(a) The One Quarter corner common to Sections 1,36

Township(s) 14,15 North, Range(s) 1 East.

Vernon County Coordinates: N 213140.647


Datum: _____ E 851914.018

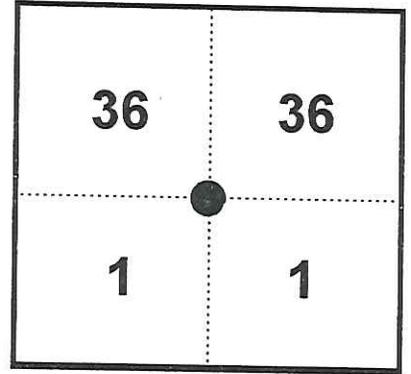

(b)(f)(h) Description of monument found at this corner and if it was accepted, state all evidence (material, testimonial, occupational, plats records, other monuments) used as a basis for accepting. If not accepted or nothing was found, state evidence used as basis for establishing location and what was set. If re-established through lost corner proportionate methods, indicate all monuments, distances and directions used.

11-8-98 - I found quarter corner monument at intersection of fence lines East, West, South and accepted as true corner location and set witness monuments as shown.


(c)(d)(e) Plan view of corner with ties to at least four (4) witness monuments. If in disagreement with previously established corner, show the distances between the two corners and also indicate ties to disputed corner.

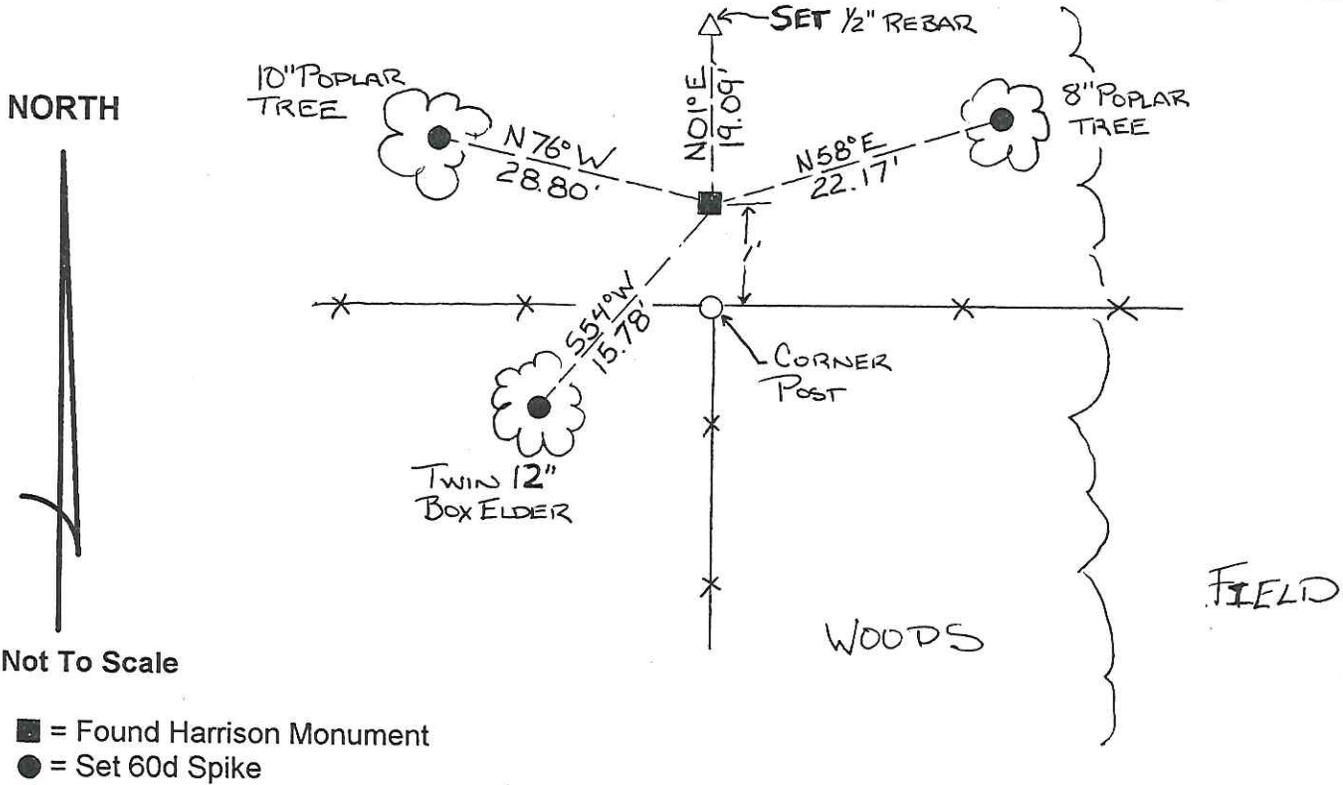

(I) Certify that the corner location on this record was determined by me or under my direction and control and that this U.S. Public Land survey Monument Record is correct and complete to the best of my knowledge and belief.

[Handwritten Signature]
Signature

11/22/98
Date

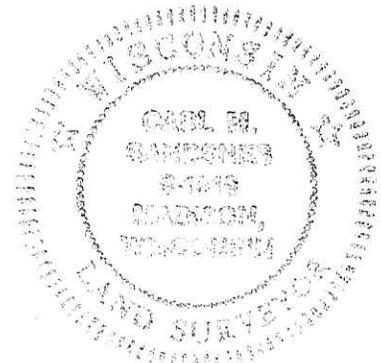

Filed for record in Vernon County Surveyor's Office on _____ INDEX NO. _____

CERTIFICATE

CERTIFIED LAND CORNER

No. 122

41501360020

I, Gary L. Dechant, do hereby certify that on the 18th day of December 1996, I found (evidence) (~~no evidence~~) of the S/4 corner of Section 36, T 15 N, R 1 E Fourth Principal Meridian, and I re-established said corner according to the Wisconsin Statutes as shown and described hereon.

Dated this 31st day of Dec. 1996.

Gary L. Dechant
 R.L.S. 1744
 Title

History of corner establishment since Original Government Survey

No known history since the original government survey.


Description of corner evidence found:

Accepted fence corner as best available evidence. Fits very well between section corners.



Description of corner and witness monuments, references and accessories used to perpetuate the original or re-established location of this corner:

Witnesses to corner location:

David E. Madison
Gary L. Dechant

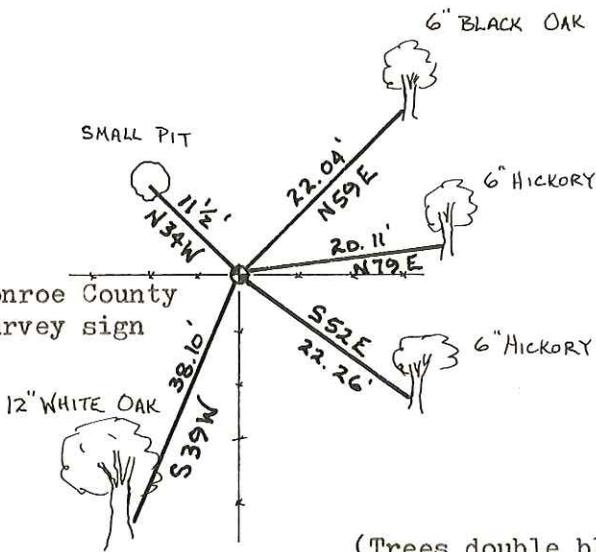

Set cast iron Monroe County monument, set survey sign 1' north.

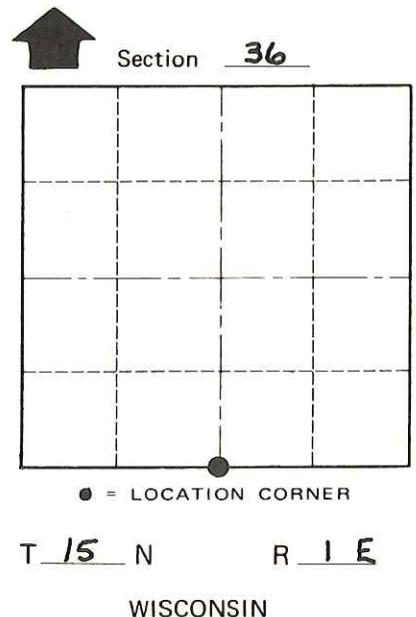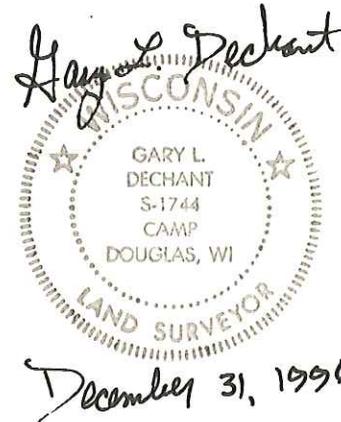

(Trees double blazed with 40d nails set)

SURVEY CONTROL ORDER

Horizontal	_____
Vertical	_____

WISCONSIN COORDINATE SYSTEM

Corner	East (X)	North (Y)	Elevation (Z)	Zone
Control Sta. Name				

~~City, Village or~~ Town GLENDALE
 County of MONROE

COUNTY SURVEYOR FORM NO. 1