

417 01072000

I, Gary L. Dechant, do hereby certify that on the 15th day of Nov. 19 96, I found ~~(evidence)~~ (no evidence) of the E/4 corner of Section 7, T 17 N, R 1 E Fourth Principal Meridian, and I re-established said corner according to the Wisconsin Statutes as shown and described hereon.

History of corner establishment since Original Government Survey

Clayton Solberg attempted to set an iron monument at this corner in his survey as recorded as doc. no. 325984.

Description of corner evidence found:

We found Solberg's iron pipe set in error. His survey shows a distance of 5218.00 between the NE and SE corners of Section 7, when in fact it measures 5318.54 feet between the said section corners, a difference of 100.54 feet. His error caused him to then set the E/4 corner in error as well.

This corner falls in a very marshy area, could not find any evidence of original. Set the E/4 corner on line and half way between section corners.

Dated this 31st day of Dec. 19 96.

Gary L. Dechant

R.L.S. 1744


Title

Description of corner and witness monuments, references and accessories used to perpetuate the original or re-established location of this corner:

Witnesses to corner location:


David E. Madison

Gary L. Dechant

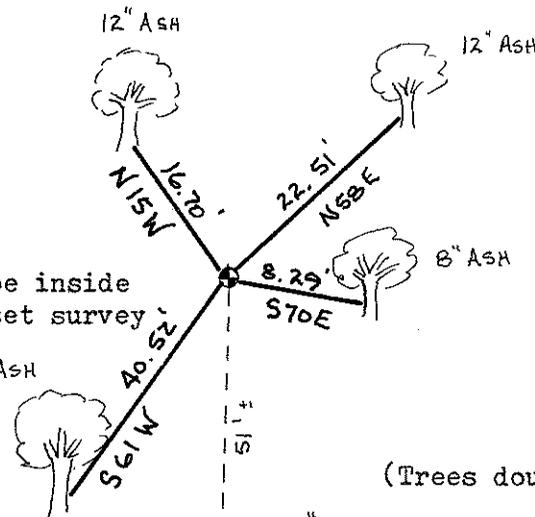


Set 1"x8' iron pipe inside 2"x3' iron pipe, set survey sign 1' north.

Ex. 1/2" IRON PIPE, LEANING, BELIEVE TO BE SOLBERG'S.

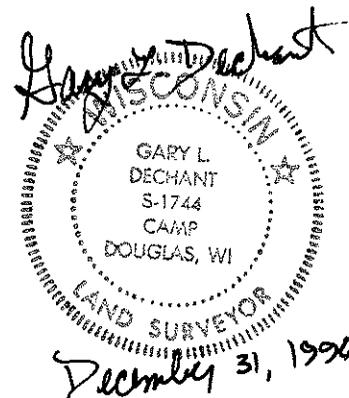

Section 7

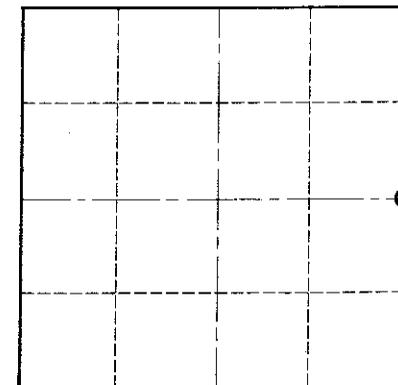

• = LOCATION CORNER

T 17 N R 1 E

WISCONSIN

SURVEY CONTROL ORDER

Horizontal	_____
Vertical	_____

WISCONSIN COORDINATE SYSTEM

Corner	East (X)	North (Y)	Elevation (Z)	Zone
Control Sta. Name				

City, Village or Town OAKDALE

County of MONROE

COUNTY SURVEYOR FORM NO. 1