

# 112

**U.S. PUBLIC LAND CORNER  
MAINTENANCE**


**Corner ID : S1/4 Sec. 30, T17N-R1E**

**41701300020**

<u>DATE</u>	<u>CREW</u>	<u>MONUMENT TYPE</u> -----
September 31, 2016	Zachariah P. Dechant Gary L. Dechant	In 2013, Laurence Johns says he found a cotton gin spike and replaced it with a Harrison. However, we found no Harrison but the cotton gin spike still in place. We replaced the cotton gin spike with a 1/4"x6' round iron bar, set new sign 2' west. Corner falls 10' south of gully.

References:

	<u>Bearing</u>	<u>Distance</u>
1) Set 3/4" x24" round iron bar, down 6", east of small mound. Set 1'x1.5' flat stone over iron bar	N52E	40.82'
2) Set 3/4"x24" round iron bar, down 6", 4' south of 14" White Oak	S60E	15.93'
3) Existing 3/4" round iron bar, 2' NE of 16" Maple (not Oak)	S61W	42.95' (41.84')
4) Set 3/4"x24" round iron bar, down 6", 5' east of 12" Maple	N29W	34.31'

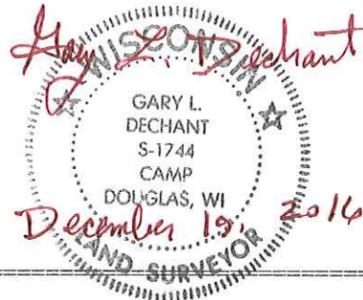


---

**U. S. PUBLIC LAND SURVEY MONUMENT RECORD**


---

SECTION 30, T17N, R1E, TOWN OF OAKDALE  
MONROE COUNTY, WISCONSIN

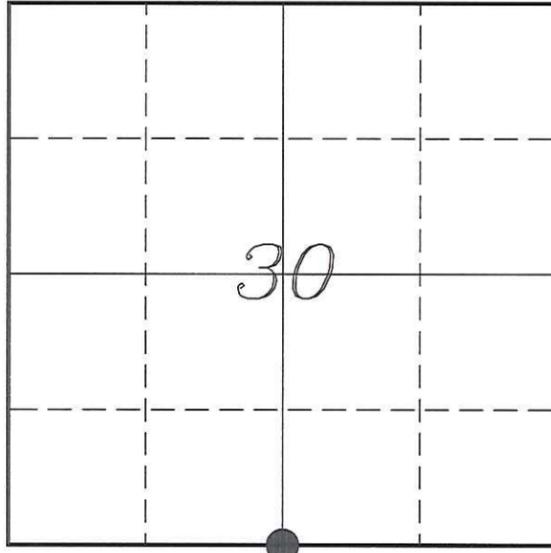

LOCATION OF LANDMARK

Witnesses: Laurence E Johns III  
Larry Handschy

Date: 20 May 2013

MONROE COUNTY COORDINATE SYSTEM	
Northing	368568.160
Easting	728946.642
Datum	NAD 1983 (1991)
Elevation	
Datum	
TYPE OF LANDMARK:	
Set Harrison Monument	
BEARINGS ARE REFERENCED TO:	
Monroe County Coordinates	

**See Reverse Side  
For Maintenance**

---

*Describe any record evidence, monument evidence, testimonial evidence or any other material evidence you considered and whether the monument was found or restored through acceptance of an obliterated evidence location.*

No bearing trees of record were located.

In February and again in December of 2002, on several surveys in Section 31, Dwayne Hefner shows a computed location for the Center of Section. He does not show how he determined this location.

Hefner also performed a survey, April 2003, in Section 31 in which he shows that he found a 3/4" iron rod at the NE Corner & The SE Corner of the SW1/4 of the NW1/4. I cannot find any record of the origination of these corners, unless Hefner set them in a earlier unrecorded survey.

I found a Cotton Gin Spike on the East side of an apparent occupational fence corner. There is some pieces of old wire in a couple of tree stumps to the West. There is a single strand of new fence wire to the North & East along with pieces of old fence wire in the same location. The only fence posts are to the North, but the wire is barely attached to it in places.

This occupational location is 31.2' East and 6.7' South of the prorational location for this corner.

I know that Hefner has used Cotton Gin Spikes in the past so I checked this location with his other surveys and found that they all matched the section breakdown based on this location. Including the 3/4" iron rods mentioned earlier.

There is no obvious occupational or previous survey evidence to discount this location so I accepted the location as the perpetuated location of the original government corner and replaced the cotton gin spike with a Harrison Monument.


---

*Describe or show any material discrepancy between the location of the restored corner and that of the corner previously restored or re-established.*

George Cole established this corner in December 1851.


## RECORD OF DURABLE WITNESS MONUMENTS

NO	DESCRIPTION	BEARING	DISTANCE
1	Set 3/4" x 18" Iron Rod In Fence - 3' West of a 9" Maple	N 01°07'53" W	70.83'
2	Set 3/4" x 18" Iron Rod 5' West of a 40" Oak	N 66°57'49" E	56.73'
3	Set 3/4" x 18" Iron Rod 1' East of a 9" Maple	S 15°53'16" W	64.45'
4	Set 3/4" x 18" Iron Rod 2' East of a 16" Oak	S 60°55'20" W	41.84'

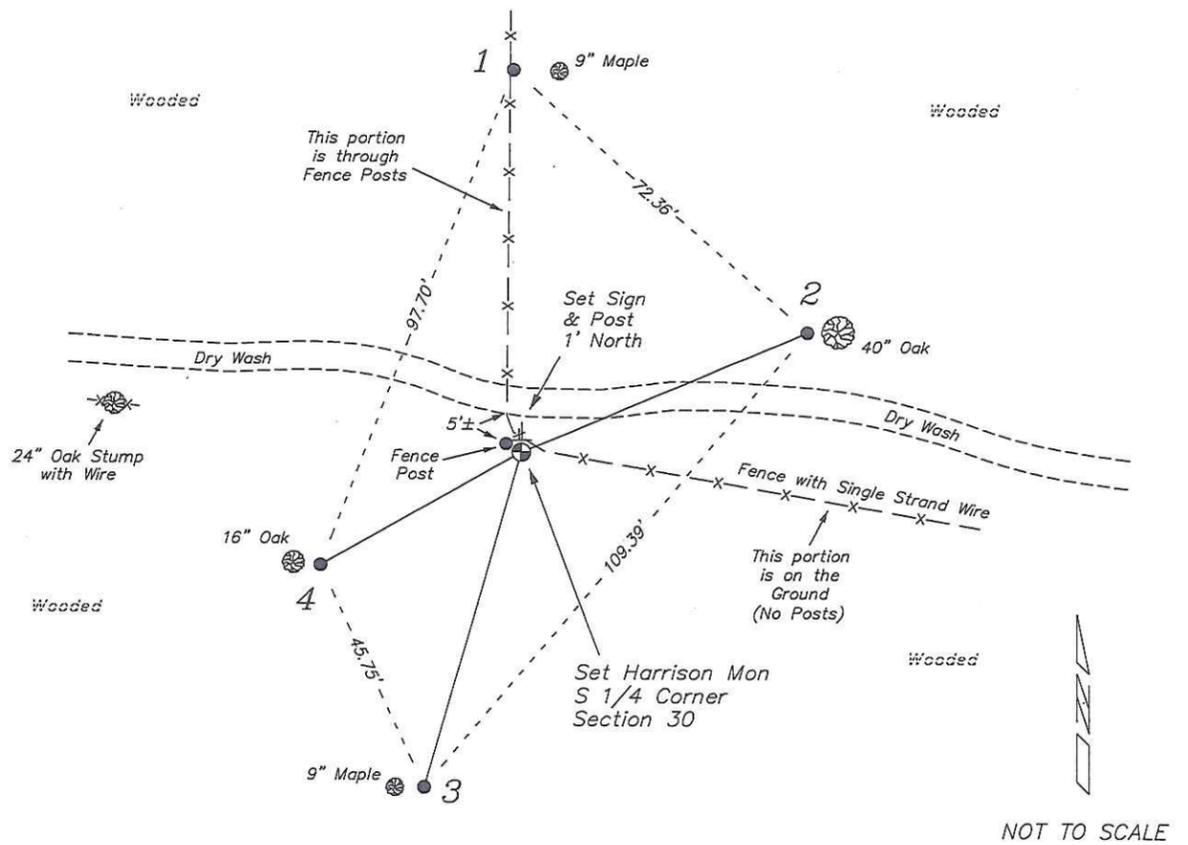

### PLAN VIEW DRAWING OF REFERENCE TIES

Map Showing Distance And Direction To Other Public Land Survey  
Corners Used For Re-Establishing The Corner

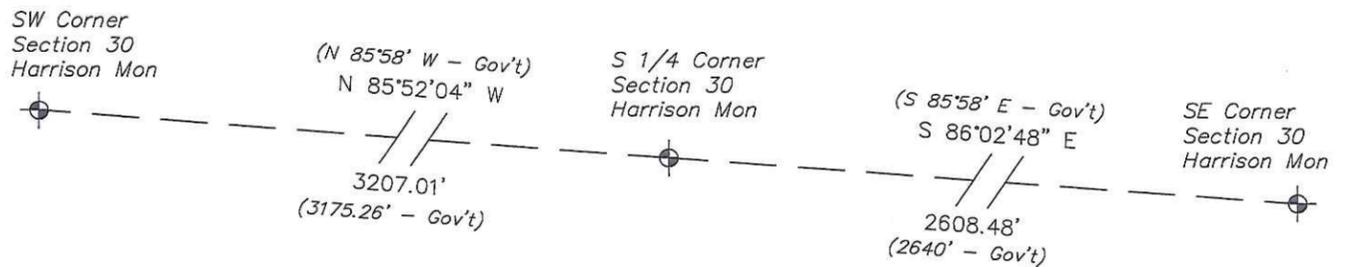

I, Laurence E Johns III RLS 2804, Registered Land Surveyor, hereby certify that the corner location shown on this record was determined by me or under my direction and control, and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

*Laurence E Johns III*  
 Laurence E Johns III RLS 2804  
 Eagle Ridge Surveying, LLC  
 PO Box 213  
 Wilton, Wisconsin  
 20 February 2013




---

U. S. PUBLIC LAND SURVEY MONUMENT RECORD  
'Addendum for Corner Photographs'

---

SECTION 30, T17N, R1E, TOWN OF OAKDALE  
MONROE COUNTY, WISCONSIN

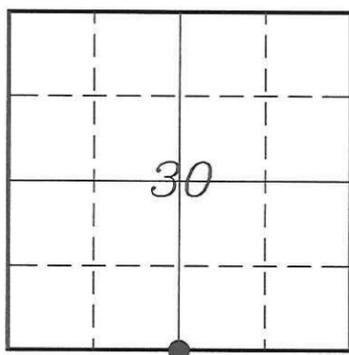

LOCATION OF LANDMARK

Date:  
20 May 2013



Taken from the South, approximately half-way toward Tie #3

**See Reverse Side  
For Maintenance**