


21502260020

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

SECTION 26, T15N, R2W, TOWN OF SHELDON MONROE COUNTY, WISCONSIN

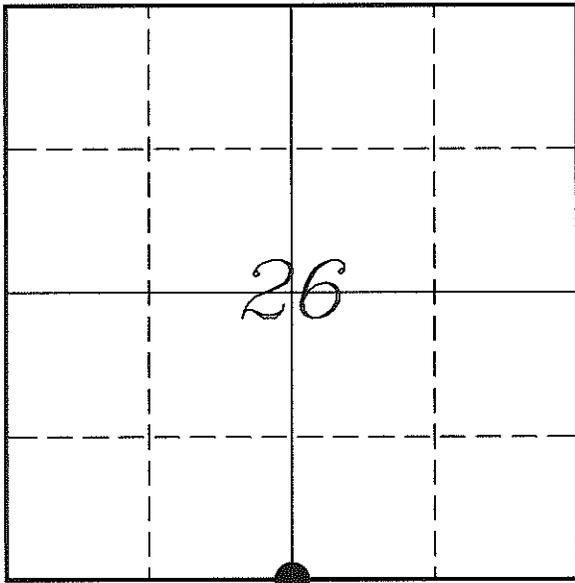

LOCATION OF LANDMARK

Witnesses: Laurence E Johns III
Larry Handschy

Date: 5 February 2013

<i>MONROE COUNTY COORDINATE SYSTEM</i>	
<i>Northing</i>	305313.300
<i>Easting</i>	686711.479
<i>Datum</i>	NAD 1983 (1991)
<i>Elevation</i>	
<i>Datum</i>	
<i>TYPE OF LANDMARK:</i>	
<i>Set Harrison Monument.</i>	
<i>BEARINGS ARE REFERENCED TO:</i>	
<i>Monroe County Coordinates</i>	

Describe any record evidence, monument evidence, testimonial evidence or any other material evidence you considered and whether the monument was found or restored through acceptance of an obliterated evidence location.

No bearing trees of record were located.

I could not find the 40d Nail set by Cornell. I did find the 1" iron pipe set by Cornell at the corner of his survey on the South line of the SW1/4 of Section 26.

I extended the North line of his survey til I hit the interesection of the fences. This location is almost 3 feet further East than shown on Cornell's map.

There has been some logging work done in the area of this corner and there is a dug road in the vicinity of this corner. It is of my opinion that though longer in distance than Cornell, it is at the same point intended by Cornell. The fences in the area are apparently in much worse condition than in 2006.

I accepted this location as the best available evidence of the original government corner and placed a Harrison Monument.

Describe or show any material discrepancy between the location of the restored corner and that of the corner previously restored or re-established.


Noah Phelps established this corner in August 1847.

Fred Holden was at this corner, in April 1911, during a survey in Section 26. He shows he re-established this corner at the mid-point between corners.

Terry Cornell was at this corner, in November 2006, during a survey in Section 35. He shows that he set a 40d Nail at the intersection of fences.


RECORD OF DURABLE WITNESS MONUMENTS

NO	DESCRIPTION	BEARING	DISTANCE
1	Set 3/4" x 18" Iron Rod In a Down Fence	N 07°55'00" W	79.63'
2	Set 3/4" x 18" Iron Rod 1' West of a 22" Oak	S 85°54'11" E	41.54'
3	Set 3/4" x 18" Iron Rod 2' South of a 30" Oak	S 48°44'29" E	25.81'
4	Set 3/4" x 18" Iron Rod 2' East of a 26" Triple Oak	S 76°18'35" W	28.60'

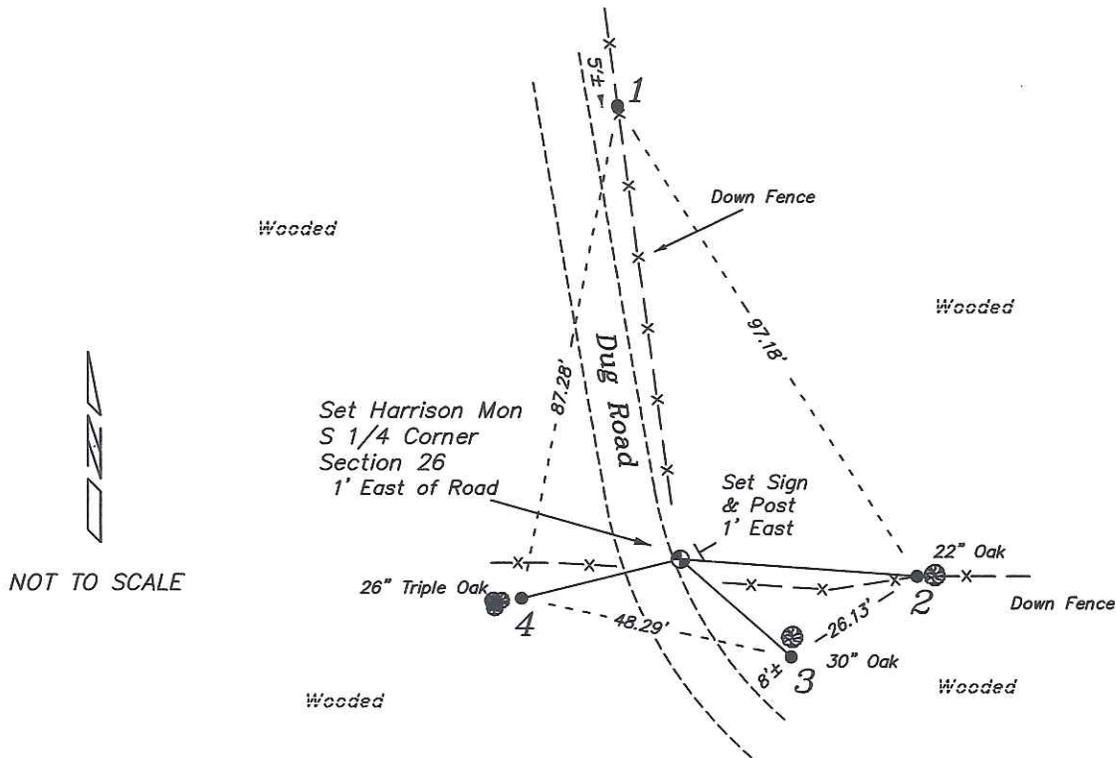

PLAN VIEW DRAWING OF REFERENCE TIES

Map Showing Distance And Direction To Other Public Land Survey Corners Used For Re-Establishing The Corner

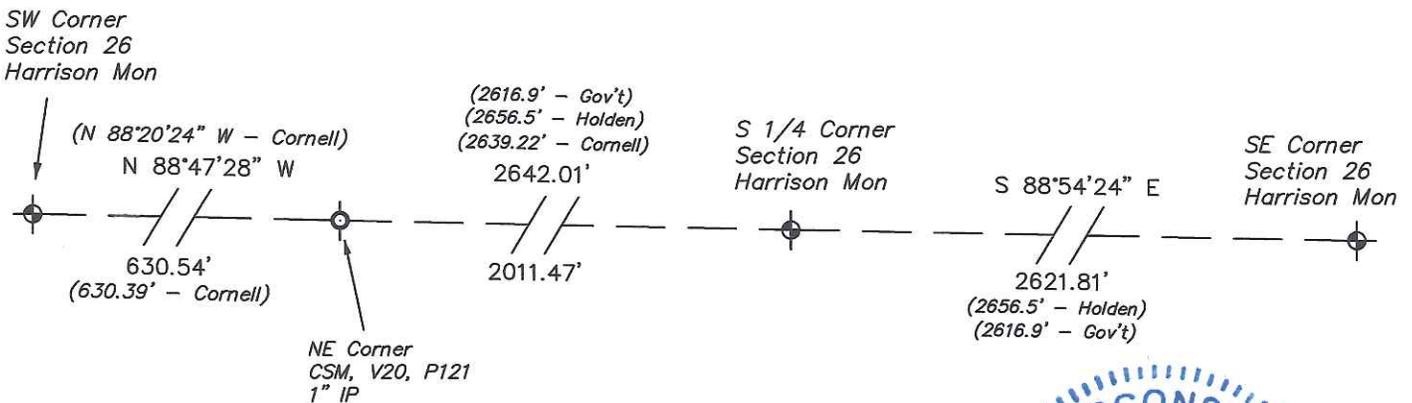


I, Laurence E Johns III RLS 2804, Registered Land Surveyor, hereby certify that the corner location shown on this record was determined by me or under my direction and control, and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Laurence E Johns III
 Laurence E Johns III RLS 2804
 Eagle Ridge Surveying, LLC
 PO Box 213
 Wilton, Wisconsin
 11 February 2013

WISCONSIN
 LAURENCE E. JOHNS III
 S-2804
 WILTON, WISCONSIN
 LAND SURVEYOR
 11 Feb 13


U. S. PUBLIC LAND SURVEY MONUMENT RECORD
'Addendum for Corner Photographs'

SECTION 26, T15N, R2W, TOWN OF SHELDON
MONROE COUNTY, WISCONSIN

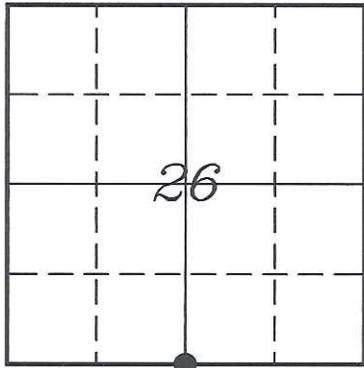

LOCATION OF LANDMARK

Date:
5 February 2013

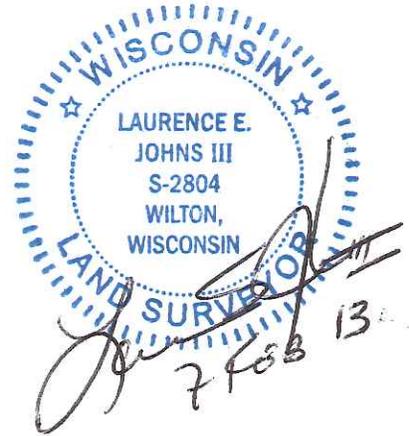

Taken from the West



Taken from the South