

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

SECTION 26, T15N, R2W, TOWN OF SHELDON MONROE COUNTY, WISCONSIN

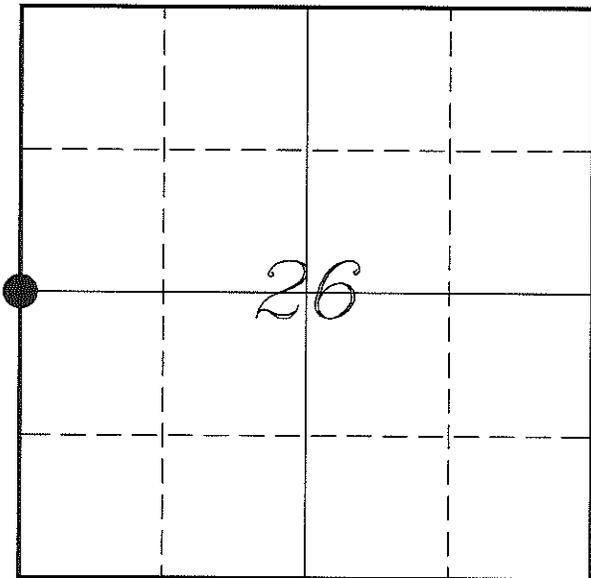

LOCATION OF LANDMARK

Witnesses: Laurence E Johns III
Larry Handschy

Date: 7 February 2013

<i>MONROE COUNTY COORDINATE SYSTEM</i>	
<i>Northing</i>	<i>307988.609</i>
<i>Easting</i>	<i>684088.309</i>
<i>Datum</i>	<i>NAD 1983 (1991)</i>
<i>Elevation</i>	
<i>Datum</i>	
<i>TYPE OF LANDMARK:</i>	
<i>Existing Harrison Monument</i>	
<i>BEARINGS ARE REFERENCED TO:</i>	
<i>Monroe County Coordinates</i>	

Describe any record evidence, monument evidence, testimonial evidence or any other material evidence you considered and whether the monument was found or restored through acceptance of an obliterated evidence location.

No bearing trees of record were located.

Found the Harrison Monument apparently set by Davies.

I checked the occupation at the '40' Corner to the South and it was East of the line between this corner and the SW Corner by 70 feet.

Using this occupation to determine this corner would affect the plat of Oil City to the point that occupation in that plat would be affected quite a bit.

With no other occupation or evidence to dispute this corner, I accepted it as the best available evidence of the original government corner.

Describe or show any material discrepancy between the location of the restored corner and that of the corner previously restored or re-established.

Noah Phelps established this corner in August 1847.

Brett Davies was at this corner, in August 2003, during a survey in Section 27. He shows that he found a Harrison Monument.


Terry Cornell was at this corner, in November 2005, during a survey in Section 27. He shows that he found a Harrison Monument at this corner.

Terry Cornell was at this corner again, in November 2006, during a survey in Section 35. He again shows that he found a Harrison Monument at this corner.

I was at this corner, in November 2010, during a survey in Section 27. I show that I found a Harrison Monument.



RECORD OF DURABLE WITNESS MONUMENTS

NO	DESCRIPTION	BEARING	DISTANCE
1	Set 3/4" x 18" Iron Rod 1' South of 10" Pine	N 88°40'05" E	66.60'
2	Set 3/4" x 18" Iron Rod 1' South of 22" Oak	S 78°57'22" E	37.63'
3	Set 3/4" x 18" Iron Rod In Crop Field - 14" Below Surface	S 15°34'50" E	103.38'
4	Set 3/4" x 18" Iron Rod 1' North of 8" Cherry	S 68°05'57" W	71.67'

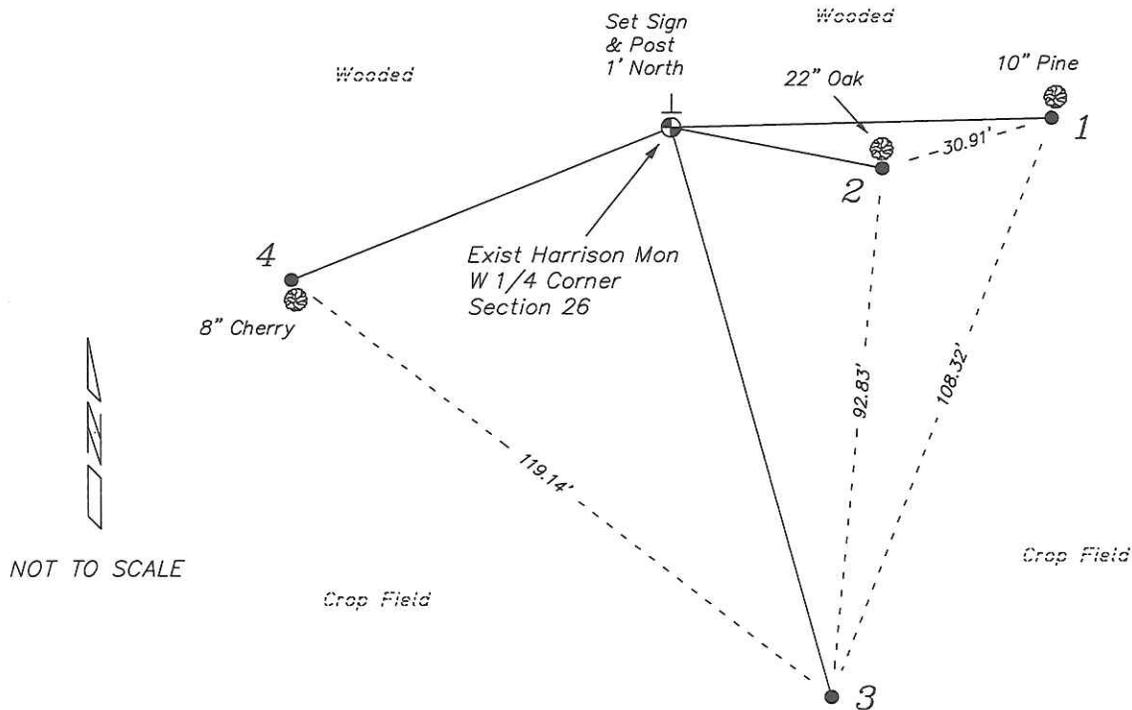

PLAN VIEW DRAWING OF REFERENCE TIES

Map Showing Distance And Direction To Other Public Land Survey Corners Used For Re-Establishing The Corner

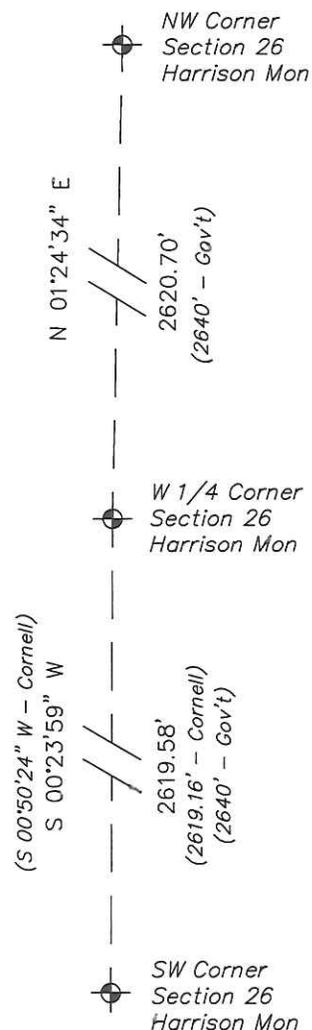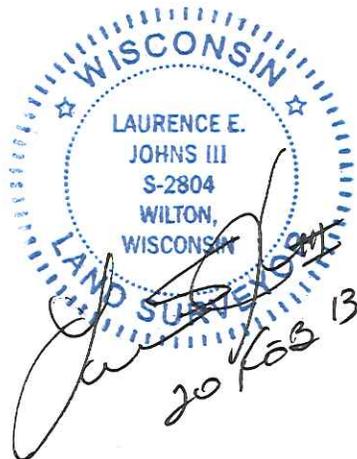


I, Laurence E Johns III RLS 2804, Registered Land Surveyor, hereby certify that the corner location shown on this record was determined by me or under my direction and control, and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Laurence E Johns III
 Laurence E Johns III, RLS 2804
 Eagle Ridge Surveying, LLC
 PO Box 213
 Wilton, Wisconsin
 20 February 2013

U. S. PUBLIC LAND SURVEY MONUMENT RECORD
'Addendum for Corner Photographs'

SECTION 26, T15N, R2W, TOWN OF SHELDON
MONROE COUNTY, WISCONSIN

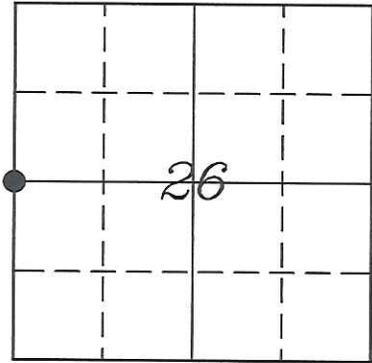

LOCATION OF LANDMARK

Date:
7 February 2013



Taken from Position #1



Taken from Position #2