

VERNON COUNTY CERTIFIED U.S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: THIS RECORD SHALL SHOW THE LOCATION OF THE CORNER AND SHALL INCLUDE ALL OF THE FOLLOWING ELEMENTS (A-I)

(A) IDENTIFY THE CORNER BY REFERENCE TO THE U.S. PUBLIC LAND SURVEY SYSTEM

■ = CORNER MONUMENT RESTORED

WITNESSES TO CORNER LOCATION:

- 1) Robert M. Lampman
- 2) Jessica A. Zamor

VERNON COUNTY COORDINATES - NAD83(1991) - SURVEY FEET


NORTHING: 210967.102

EASTING: 788405.391

MONROE COUNTY COORDINATES - NAD83(1991) - SURVEY FEET

NORTHING: 300021.046

EASTING: 691954.127

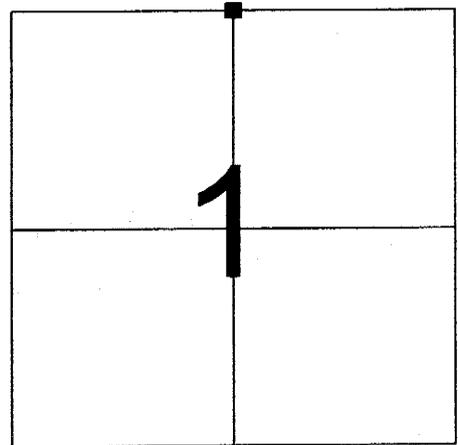

SECTION 1
TOWN 14 NORTH, RANGE 2 WEST

(B) DESCRIBE ANY RECORD EVIDENCE, MONUMENT EVIDENCE, OCCUPATIONAL EVIDENCE, TESTIMONIAL EVIDENCE OR ANY OTHER MATERIAL EVIDENCE YOU CONSIDERED, AND WHETHER THE MONUMENT WAS FOUND OR PLACED.

Accepted location of existing 1" o.d. iron pipe at the occupied fence corner as the best available evidence of the original corner location. Replaced the existing iron pipe with a Vernon County Lunde Monument.

The accepted corner location is approximately 5.7' easterly and 8.9' northerly of a position determined by single proportionate measurement between the Northeast and Northwest corners of Section 1. Examined occupational evidence along the North line of the NW 1/4 of Section 1 and the North/South one-quarter line of Section 36, T15N, R2W and found no evidence in support of shifting the location westerly or southerly. Therefore, accepted the iron pipe at occupation as the best available evidence.


(See corner history on reverse side of sheet.)

(C) IN THE PLAN VIEW DRAWING BELOW, PROVIDE REFERENCE TIES TO AT LEAST 4 WITNESS MONUMENTS OR, IF THE LOCATION IS WITHIN A MUNICIPALITY, TO AT LEAST 2 WITNESS MONUMENTS. (WITNESS MONUMENTS SHALL BE MADE OF CONCRETE, NATURAL STONE, IRON, OR OTHER EQUALLY DURABLE MATERIAL.) DESCRIBE WITNESS MONUMENTS.

(D) SHOW A PLAN VIEW DRAWING, DEPICTING THE RELEVANT MONUMENTS AND REFERENCE TIES, WHICH IS SUFFICIENTLY DETAILED TO ENABLE ACCURATE RELOCATION OF THE CORNER MONUMENT IF IT IS DISTURBED.

LEGEND

- SET VERNON COUNTY LUNDE MONUMENT IN PLACE OF EXISTING 1" o.d. IRON PIPE
- SET 3/4" X 24" ROUND IRON BAR FOR WITNESS MONUMENT

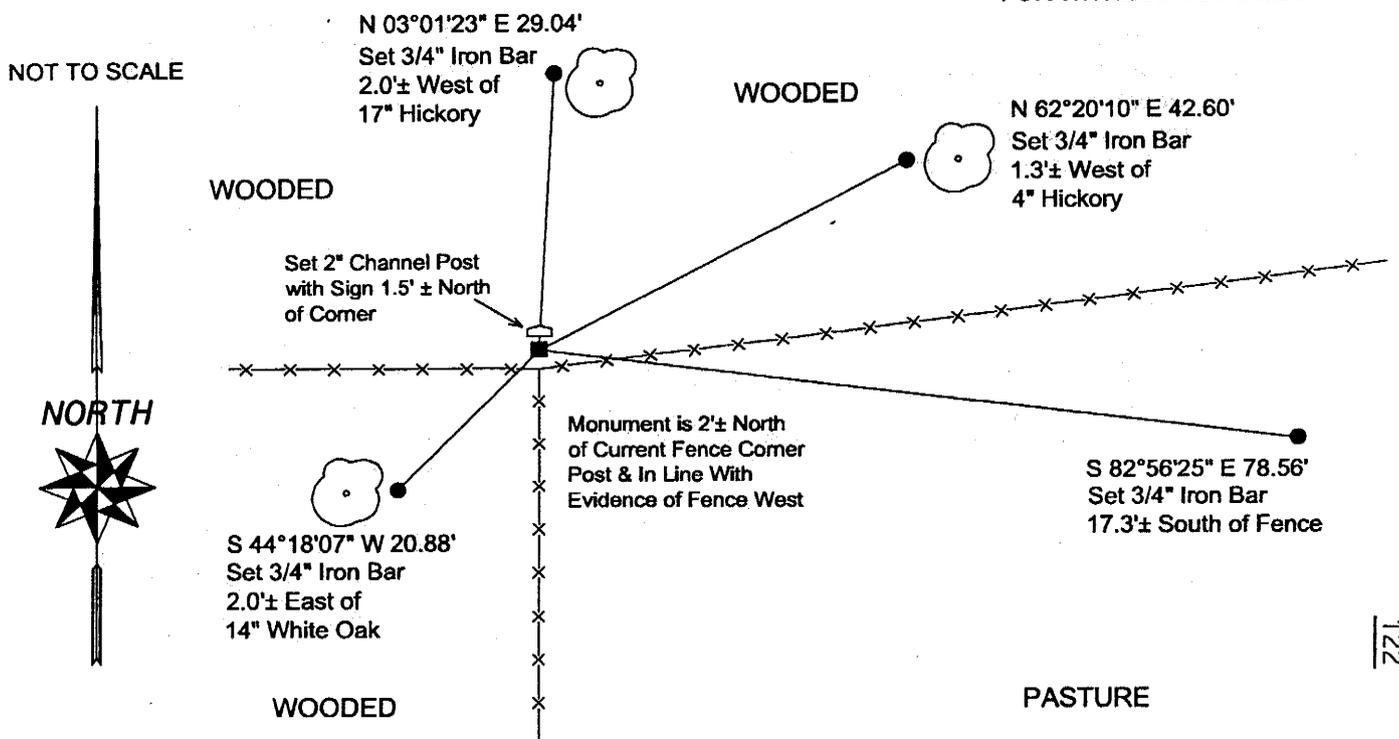

(E) DESCRIBE ANY MATERIAL DISCREPANCY BETWEEN THE LOCATION OF THE CORNER AS RESTORED OR REESTABLISHED AND THE LOCATION OF THAT CORNER AS PREVIOUSLY RESTORED OR REESTABLISHED BY DISTANCE AND DIRECTION. SHOW THE DISCREPANCY ON THE PLAN VIEW DRAWING UNDER (D), ABOVE. SHOW THE DISTANCES BETWEEN THE CORNER AS PREVIOUSLY RESTORED OR REESTABLISHED AND (1) THE CORNER AS RESTORED OR REESTABLISHED, AND (2) TO AT LEAST 2 OF THE WITNESS MONUMENTS AS SHOWN ON THE DRAWING IN (D), ABOVE.

N/A

(F) WAS THE CORNER RESTORED THROUGH ACCEPTANCE OF (1) AN OBLITERATED EVIDENCE LOCATION, OR (2) A FOUND PERPETUATED LOCATION?

(2) A FOUND PERPETUATED LOCATION

(G & H) WAS THE CORNER REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS? IF SO SHOW THE METHOD, INCLUDING THE DIRECTIONS AND DISTANCES TO OTHER PUBLIC LAND SURVEY CORNERS USED AS EVIDENCE OR USED FOR PROPORTIONING IN DETERMINING THE CORNER LOCATION.

N/A

(**) ANY ADDITIONAL INFORMATION RELATED TO CORNER LOCATION

CORNER HISTORY:


-Original government corner location established by Uriah Biggs in 1845.

-Alex Ristow utilized this corner as part of a subdivision of Section 1, T14N, R2W dated January of 1906. Ristow's survey lists the corner as government and does not include a description of any particular monument at the corner or witnesses for the corner.

-James Carroll shows a 1-1/4" x 24" iron pipe set at the corner on a survey located in part of Section 36, T15N, R2W. I am uncertain of the exact date of this survey.

-Patrick Carroll shows a 1" iron pipe found in place at the corner on Vernon County Certified Survey Map No. 68, Volume 4, Page 157, Document No. 365807 and Vernon County Certified Survey Map No. 175, Volume 5, Page 107, Document No. 381684. Said Certified Survey Maps being dated February of 1998 and May of 2000 respectively. Patrick Carroll also shows a 1" iron pipe found in place on a Plat of Survey located in part of Section 1, T14N, R2W and dated October 5, 2002.

(I) I, ROBERT M. LAMPMAN, CERTIFY THAT THE LOCATION SHOWN ON THIS RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

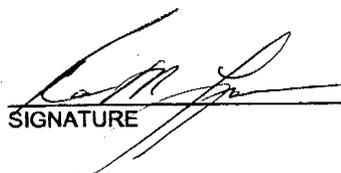
SIGNATURE

3-10-04
DATE

AFFIX LAND SURVEYOR SEAL

