

# 99

**U.S. PUBLIC LAND CORNER  
MAINTENANCE**

**Corner ID :** E1/4 Sec. 26, T18N-R2W  
**21802262000**

<u>DATE</u>	<u>CREW</u>	<u>MONUMENT TYPE</u> -----
June 29, 2016	Zachariah P.Dechant Gary L. Dechant	Existing 1 1/4" round iron bar old Railroad bed Approx. 140' east of abandoned Railroad tunnel.

References:

	<u>Bearing</u>	<u>Distance</u>
1) Set 3/4"x24" round iron bar, down 6"	N80E	31.35'
2) Set 3/4"x24" round iron bar, down 6", on top of sluff from slope	S59 <del>E</del>	26.98"
3) Set 3/4"x24" round iron bar, down 6" in old railroad bed	N83W	33.09
4) Set 3/4"x24" round iron bar, down 6"	N18W	16.35"



I, Gary L. Dechant, do hereby certify that on the 12th day of April 1988, I found ~~(evidence)~~ (no evidence) of the W<sup>1</sup>/<sub>4</sub> corner of Section 25, T 18 N, R 2 W Fourth Principal Meridian, and I re-established said corner according to the Wisconsin Statutes as shown and described hereon.

Dated this 13th day of April 1988.

Gary L. Dechant

Reg. Land Surveyor, S-1744  
Title

History of corner establishment since Original Government Survey

Bill Jung has a computed location for this corner shown on his Section 26 summary surveyed in 1974.

Description of corner evidence found:

My distance between the NW and SW Section corners differ by 1.58 feet from Bill Jung's. I set the corner on line between Section corners at a prorated distance to Jung's measurements, This corner was also located from existing monuments within the Village of Tunnel City. However it should be noted, that this corner location fits the North line of the Village of Tunnel City in a North South direction, but is about 2 chains farther East as indicated on the Plat of Tunnel City which would make some lots as shown on said Plat non-existent! After reviewing the evidence of Bill Jung's survey and my own I am under the opinion that an error was made in the Village of Tunnel City when platted in 1858.

Description of corner and witness monuments, references and accessories used to perpetuate the original or re-established location of this corner:

Witnesses to corner location:

David E. Madison

Gary L. Dechant

COUNTY SURVEYOR FORM NO. 1

See Reverse Side For Maintenance



SURVEY CONTROL ORDER

Horizontal	_____
Vertical	_____

Corner	East (X)	North (Y)	Elevation (Z)	Zone
Control Sta. Name				



Set 1 1/4"x30" round iron bar 4'± South of centerline of abandoned railroad. Distances from corner to tip of arrows. Sign set south side. (EAST VIEW)

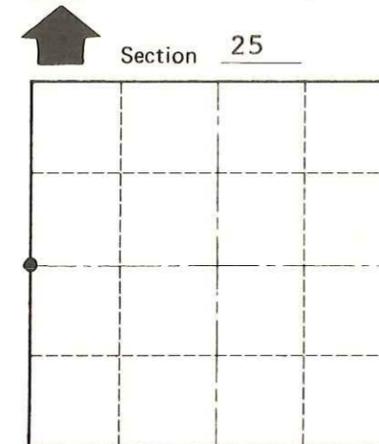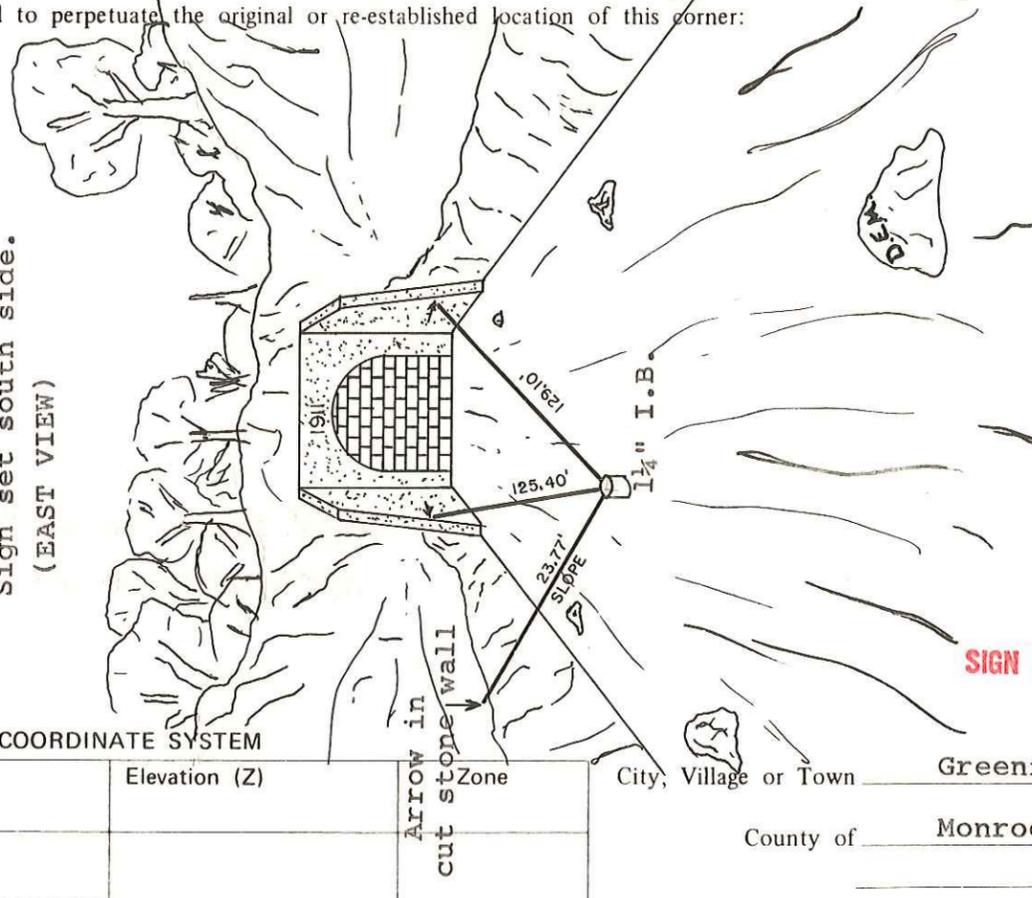

• = LOCATION CORNER

T 18 N R 2 W

WISCONSIN

SIGN PLACED 8-27-92

City, Village or Town Greenfield  
County of Monroe