


*U. S. PUBLIC LAND SURVEY MONUMENT RECORD*

*SECTION 16, T19N, R3W, TOWN OF NEW LYME  
MONROE COUNTY, WISCONSIN*

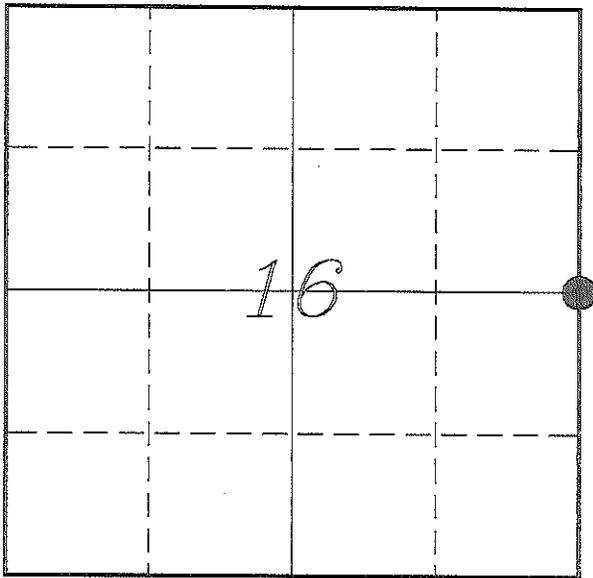

*LOCATION OF LANDMARK*

<i>MONROE COUNTY COORDINATE SYSTEM</i>	
<i>Northing</i>	<i>444652.151</i>
<i>Easting</i>	<i>647042.955</i>
<i>Datum</i>	<i>NAD 1983 (1991)</i>
<i>Elevation</i>	
<i>Datum</i>	
<i>TYPE OF LANDMARK:</i>	
<i>Set Harrison Monument</i>	
<i>BEARINGS ARE REFERENCED TO:</i>	
<i>Monroe County Coordinates</i>	

*Witnesses:* Laurence E Johns III  
Al Hoff

*Date:* 10 June 2014

*Describe any record evidence, monument evidence, testimonial evidence or any other material evidence you considered and whether the monument was found or restored through acceptance of an obliterated evidence location.*

No bearing trees of record were located.

There is no evidence of occupation in the vicinity of this corner.

The only surveyors in this area, since the original government survey, have been surveyors working for Fort McCoy, none of which show any monument at this location.

There is a '40' Corner set just East of the W 1/4 Corner of Section 16. There is no occupational evidence East of that '40' Corner. That survey does not indicate how it was determined. That '40' Corner lies 10.8 feet South of the straight line between the W 1/4 Corner and this corner.

I determined this corner to be lost and set a Harrison Monument at the location determined by lost-corner procedures.

*Describe or show any material discrepancy between the location of the restored corner and that of the corner previously restored or re-established.*


John Dunn established this corner in November 1846.

Surveyors working for the US Corps of Engineers were along the East line of Section 16, in 1945, during a survey of the boundary of Fort McCoy. There appears to be no record of this corner being set during that survey.

Nicholas Hillmer was along the East line of Section 16, in May 2013, during a survey of the boundary of Fort McCoy. He makes no mention of this corner in his survey.



## RECORD OF DURABLE WITNESS MONUMENTS

NO	DESCRIPTION	BEARING	DISTANCE
1	Set 3/4" x 18" Iron Rod 4' East of a 15" Black Oak	N 38°01'15" W	41.98'
2	Set 3/4" x 18" Iron Rod 3' West of a Double 15" Black Oak	N 25°08'37" E	74.40'
3	Set 3/4" x 18" Iron Rod 4' West of a Triple 18" Black Oak	S 15°44'29" E	74.87'
4	Set 3/4" x 18" Iron Rod 3' North of a 28" White Oak	S 18°12'27" W	126.44'

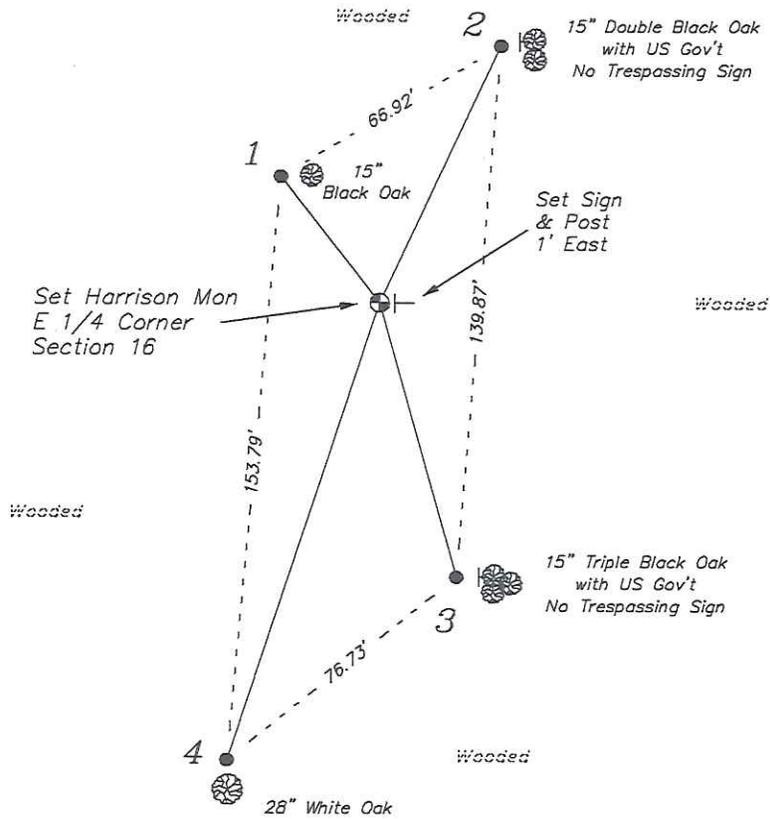

### PLAN VIEW DRAWING OF REFERENCE TIES

Map Showing Distance And Direction To Other Public Land Survey Corners Used For Re-Establishing The Corner

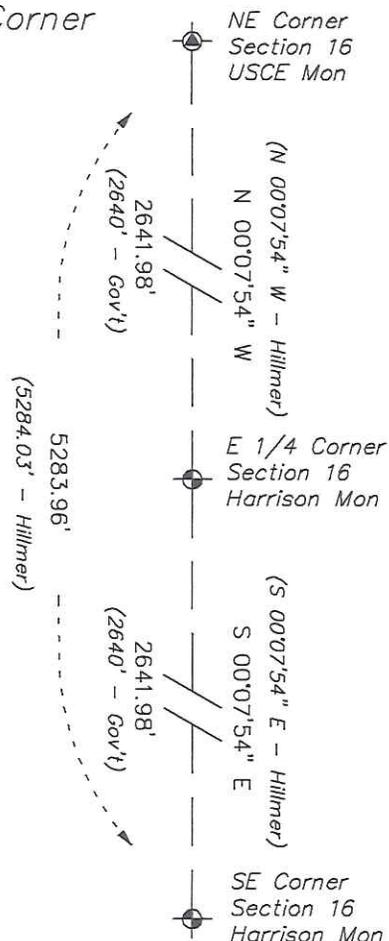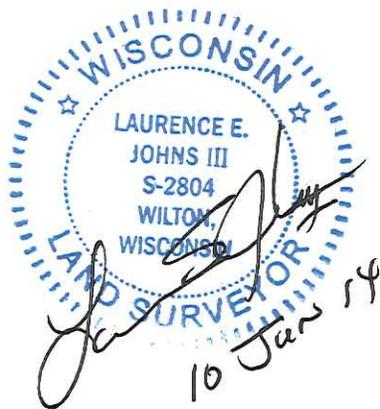

I, Laurence E Johns III RLS 2804, Registered Land Surveyor, hereby certify that the corner location shown on this record was determined by me or under my direction and control, and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

*Laurence E. Johns III*  
 Laurence E Johns III RLS 2804  
 Eagle Ridge Surveying, LLC  
 PO Box 213  
 Wilton, Wisconsin  
 10 June 2014