


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

SECTION 32, T19N, R3W, TOWN OF NEW LYME
MONROE COUNTY, WISCONSIN

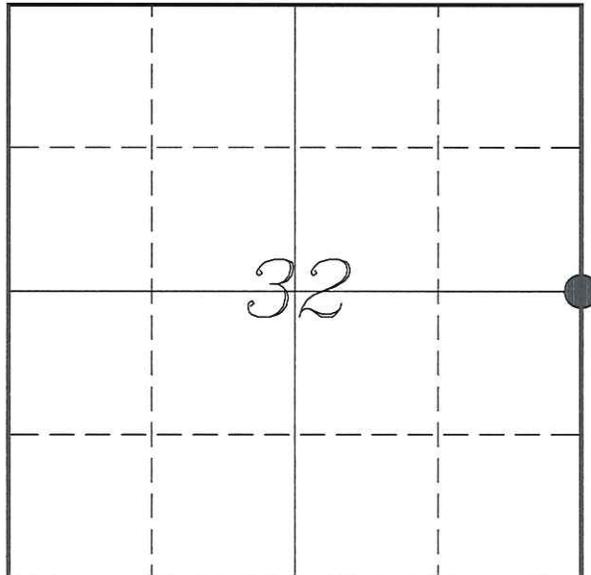

MONROE COUNTY COORDINATE SYSTEM	
Northing	428751.749
Easting	641730.889
Datum	NAD 1983 (1991)
Elevation	
Datum	
TYPE OF LANDMARK:	
Set Harrison Monument	
BEARINGS ARE REFERENCED TO:	
Monroe County Coordinates	

LOCATION OF LANDMARK

Witnesses: Laurence E Johns III
Larry Handschy

Date: 24 October 2013

Describe any record evidence, monument evidence, testimonial evidence or any other material evidence you considered and whether the monument was found or restored through acceptance of an obliterated evidence location.

No bearing trees of record were located.

The computed location for Keach's corner (equi-distance between corners) came to a point that was approximately 16' East of a wooden post at at field corner. We did not find Keach's stone at this corner. But when excavating in the proximity of the equi-distance location in the field, we found what appears to be a square stone on its side at approximately 1' below the surface.

Both the SW Corner and the NW Corner are stones that were recovered from Keach's survey. With this in thought, I set this corner at equal distance and straight line between the section corners. This location is supported by what I believe to be Keach's stone.

The Harrison is on the Southeast side of the stone and approximately 12" below the surface.

Describe or show any material discrepancy between the location of the restored corner and that of the corner previously restored or re-established.

John Dunn established this corner in November 1846.


Hamilton La Rue may have been at this corner, in March 1897. His narrative does not mention this corner but he set the '40' Corner between this corner & the SE Corner of the Section.

C M Keach was at this corner, in May 1904, during a survey in Section 33. He shows that he re-established this corner at equal distance and set a stone.

Fred Holden was at this corner, in September 1905, during a survey in Section 32. He shows that he found Keach's corner.


RECORD OF DURABLE WITNESS MONUMENTS

NO	DESCRIPTION	BEARING	DISTANCE
1	Set 3/4" x 18" Iron Rod 13' South of a 12" White Oak	N 00°32'15" W	220.73'
2	Set 3/4" x 18" Iron Rod South Side of Large Wooden Post	N 74°25'13" W	16.46'
3	Set 3/4" x 18" Iron Rod In Field - 12" Below Surface	S 13°33'13" E	84.29'
4	Set 3/4" x 18" Iron Rod 6' South of a 22" Pine	N 83°35'06" W	113.30'

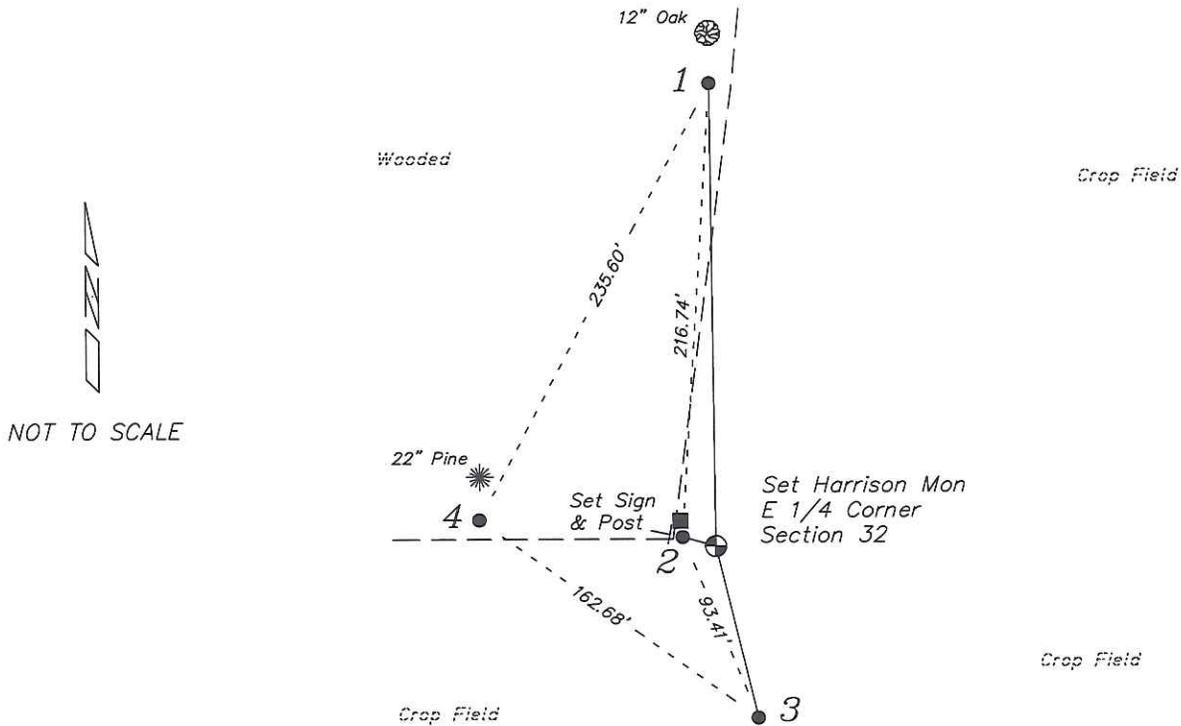

PLAN VIEW DRAWING OF REFERENCE TIES

Map Showing Distance And Direction To Other Public Land Survey
Corners Used For Re-Establishing The Corner

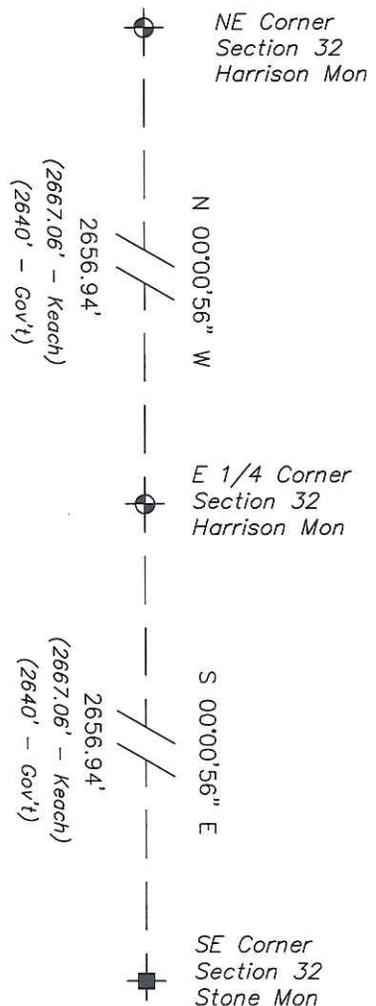

I, Laurence E Johns III RLS 2804, Registered Land Surveyor, hereby certify that the corner location shown on this record was determined by me or under my direction and control, and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Laurence E. Johns III

Laurence E Johns III RLS 2804
Eagle Ridge Surveying, LLC
PO Box 213
Wilton, Wisconsin
24 October 2013