


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

SECTION 33, T19N, R3W, TOWN OF NEW LYME
MONROE COUNTY, WISCONSIN

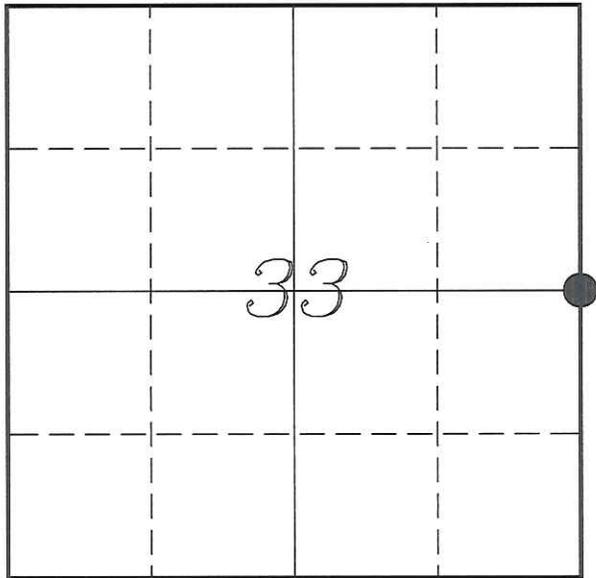

LOCATION OF LANDMARK

MONROE COUNTY COORDINATE SYSTEM	
Northing	428759.176
Easting	647012.238
Datum	NAD 1983 (1991)
Elevation	
Datum	
TYPE OF LANDMARK:	
Set Harrison Monument	
BEARINGS ARE REFERENCED TO:	
Monroe County Coordinates	

Witnesses: Laurence E Johns III
Larry Handschy

Date: 24 October 2013

Describe any record evidence, monument evidence, testimonial evidence or any other material evidence you considered and whether the monument was found or restored through acceptance of an obliterated evidence location.

No bearing trees of record were located.

No evidence was found of the stone set by Keach at this corner. It may have been disturbed by construction and widening of Burma Road.

Hilmer shows the boundary of Ft McCoy to be straight line through this corner.

Keach re-established this corner at at equal distance between the NE & SE Corners of the Section.

I re-established this corner using the same method as Keach. This location would put the East/West Quarter line within 2 feet of a railroad tie post which may represent his center of section.

I accepted this location as the best available and set a Harrison Monument.

Describe or show any material discrepancy between the location of the restored corner and that of the corner previously restored or re-established.


John Dunn established this corner in November 1846.

C M Keach was at this corner, in May 1904, during a survey in Section 33. He shows that he re-established this corner at equal distance and set a stone.

Nicholas Hillmer was through this corner, in May 2013, during a survey of the Ft McCoy boundary. He does not show this corner being set during his survey.


RECORD OF DURABLE WITNESS MONUMENTS

NO	DESCRIPTION	BEARING	DISTANCE
1	Set 3/4" x 18" Iron Rod In Down Fence - 6' South of 30" Oak	N 00°18'21" W	94.22'
2	Set 3/4" x 18" Iron Rod 1' South of a Split Trunk Ash	N 78°19'29" E	87.02'
3	Set 3/4" x 18" Iron Rod 1' North of a 12" Pine	S 06°50'26" E	77.32'
4	Set 3/4" x 18" Iron Rod 1' East of a 4" Oak	N 82°45'59" W	94.93'

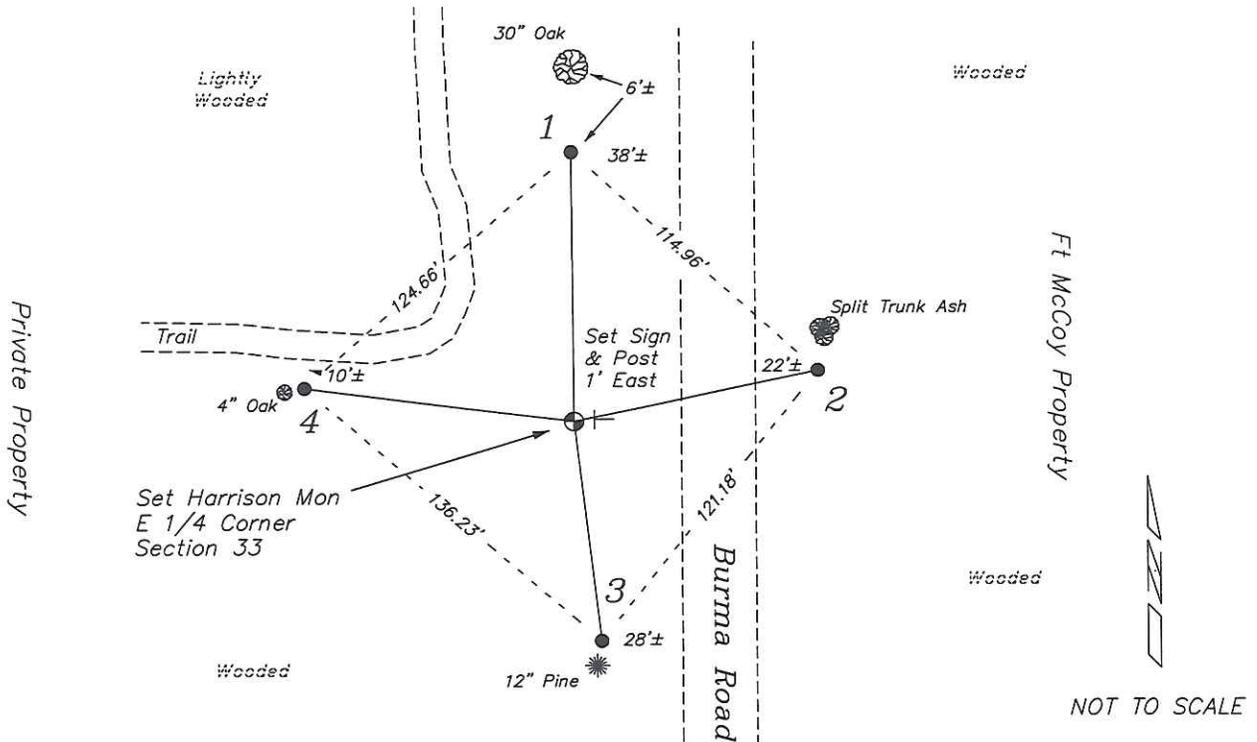


PLAN VIEW DRAWING OF REFERENCE TIES

Map Showing Distance And Direction To Other Public Land Survey
Corners Used For Re-Establishing The Corner

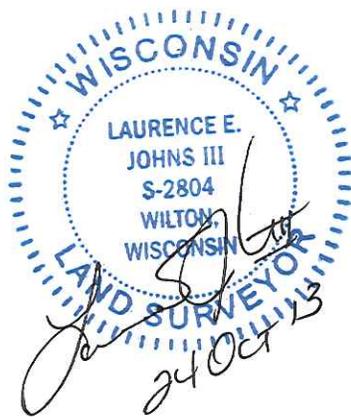

I, Laurence E Johns III RLS 2804, Registered Land Surveyor, hereby certify that the corner location shown on this record was determined by me or under my direction and control, and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

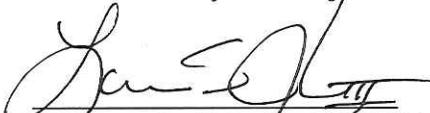
 Laurence E Johns III RLS 2804
 Eagle Ridge Surveying, LLC
 PO Box 213
 Wilton, Wisconsin
 24 October 2013

