CERTIFICATE OF SURVEY—COUNTY SURVEYOR. 5-1-3 Printed and for sale by R. H. GILE, Milwaukee, Wis.

Office of ~~County~~ Surveyor,
Monroe County, Wis.

Sec. 23 Town 15 N., Range 2 W. 4th P. M.

Var. 4° East.

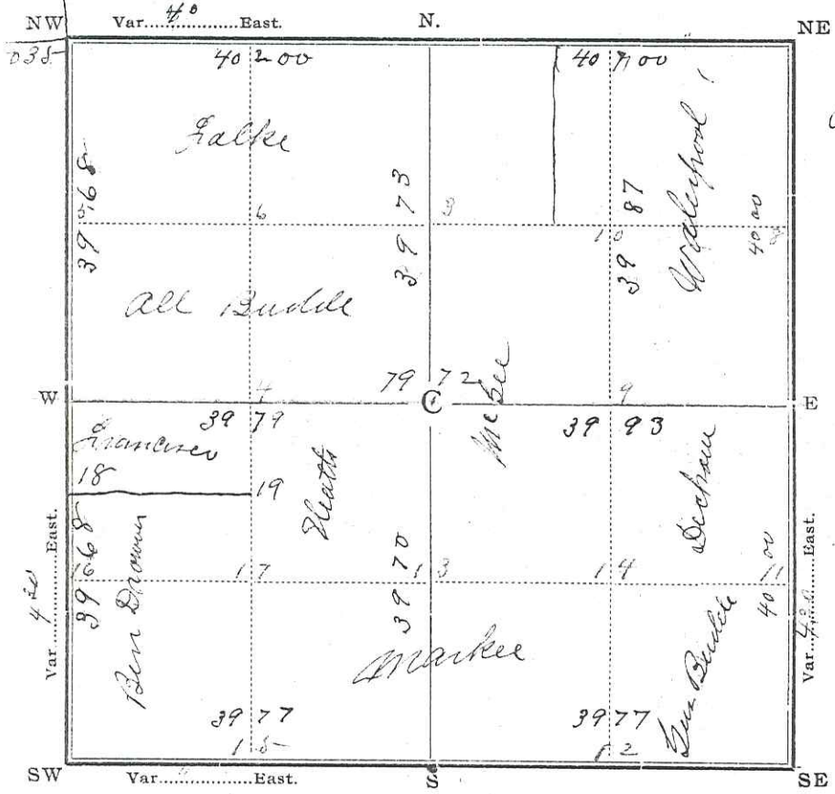

REMARKS.

Survey made May 24 to 29 inc 1911
Sworn assistants
Chainmen Ed Heath
Emil Budde
Flagmen All Budde
W. L. Markee
Axman Edgar Wattfurd
Ben Drawer
Lines run by rods fine and hook sights all corners stakes created Northwest Corner lost re-established in accordance with U. S. rules for the restoration of lost corners

TABLE OF CORNERS.

CORNER	BEARING TREES.	DIAM. INCHES.	BEARING.	LINKS DISTANT.	REMARKS.
NE	W.O. Stp.	36	S3 W	48	Original
NW	Pin O.	14	S84E	104	re-established
	Hickory	10	S59½E	50	
SW	W.O. Stp.		N51 W	8	Original
	W.P.		S33 E	30	"
	Set 3/4	Pipe	Quadruple Bass	N 9E 19½ new	
SE	W.P. Stp.	36	N60 W	48	Original
N	Cotton. Dbl.		Cottonwood E	103	Re-Estab
	Set 1/2	in.	Iron Pipe		in Line
S	W.P. Stp.	20	S10 E	8	Original
	Elm	18	S36½E	62 new	Markee
E	Cherry	6	N12 E	64	Re-Estab
	Bro.	5	N16 W	75¾	in Line
W					Re-Estab.
	Set 2	in	Pipe at Cor		in Line
C	Set 2	in	Pipe at	intersect	stat 1/4 Line
	Blk O.	12	N38½W	67½	
2					
3	2 in Pipe		at Corner		

CORNER	BEARING TREES	DIAM. INCHES.	BEARING.	LINKS DISTANT.	REMARKS.
4	Set Iron pipe		at Corner		
5	2 in Pipe		at Corner		
6	Stake		at Corner		
7	Joint Linden				
	in Bunch of 6	12 in	S64 E	5-5	
8	Stake				
9	1¼ Pipe		at corner		
10	1½ Pipe		at Corner		
11	1½ Pipe		at Corner		
12	Set 2	in	Iron Pipe		at Corner
13	3/4 Pipe		at Cor		
	Elm	20	S73½E	82½	
14	Set 1/2	in	Pipe		
15	Bro.	10	S65 E	69	
	Set 3/4		Pipe		
16	Stake		in Line		
17	Set 1	in	Pipe		
18	Set 3/4	Gal	Pipe	at Cor	
19	Elm	18	S24½E	28	

I hereby certify that the above Diagram and Field Notes are correct of the ..... Survey of Section 23 Town 15 N., Range 2 W., as surveyed by direction of Ed Heath Etal

Dated this 29th day of April 1911.

Fred A. Hotz

~~County~~ Surveyor, Monroe County, Wis.

CSR 1097