


**U.S. PUBLIC LAND CORNER
MAINTENANCE**

98

**Corner ID: E1/4 Sec.27, T18N-R1W
21801272000**

<u>DATE</u>	<u>CREW</u>	<u>MONUMENT INFO</u>
May 20, 2020	Zachariah P. Dechant Gary L. Dechant	Found 2½" witness pipe. Stump has rooted away, thus set 1¼"x5" iron pipe 2.5' west of witness pipe at actual corner. Corner falls in remnants of north-south fencing, 18' west of north-south ditch. Set sign 1/2' north. Marshy conditions.

	<u>Compass Bearing</u>	<u>Distance</u>
1) Existing 2½" iron pipe	East	2.50'
2) Set 3/4"x24" round iron bar, 4' NW of 15" Black oak	S10E	12.95'
3) Set 3/4"x24" round iron bar, 4' east of 10" Poplar	West	31.05'
4) Set 3/4"x3' round iron bar, 4' SW of 8" Birch	N33E	19.62'

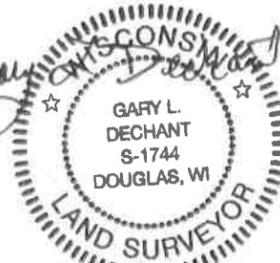Gary L. Dechant

 May 27, 2020

I, Bryan H. Meyer, do hereby certify that on the 20th day of August 1985, I found (evidence) ~~no evidence~~ of the East $\frac{1}{4}$ corner of Section 27, T 18 N, R 1 W Fourth Principal Meridian, and I re-established said corner according to the Wisconsin Statutes as shown and described hereon.

Dated this 30th day of Dec. 1986

Bryan H. Meyer
Deputy County Surveyor
Title

History of corner establishment since Original Government Survey

Harley A. Sime was here in August of 1961. Mr. Sime was here again in April of 1967 and shows a tree at the corner. He set an iron pipe 2.5 feet East as a witness. Duke Marten was here in May 1974. The County Surveyors Office was here sometime in 1974. (See page 1)

Description of corner evidence found:

I found the stump of Mr. Sime's tree. I would have liked to have set a permanent marker at the actual corner but the stump is still quite solid and does have wire wrapped around it. I found Mr. Simes reference pipe and got ties for it.



COUNTY SURVEYOR FORM NO. 1

Description of corner and witness monuments, references and accessories used to perpetuate the original or re-established location of this corner:



Crew: Meyer, Wilhite
Date: August 20, 1985

Witnesses to corner location:

Dallas Wilhite
Bryan Meyer

NOTE: The four trees shown are double blazed; each distance shown is to a nail set in a hack in the side of each tree.

16"+ stump with wire wrapped around at the actual corner.

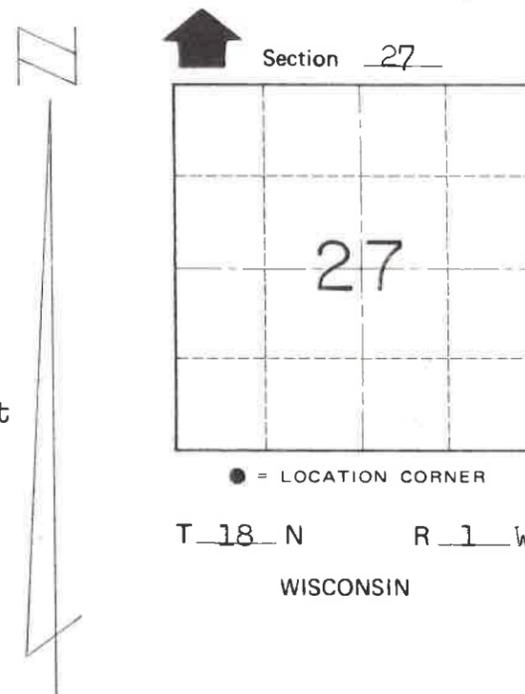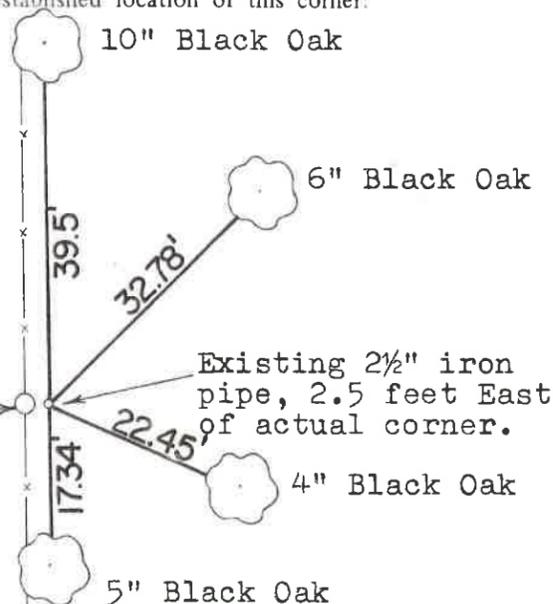

See Reverse Side For Maintenance

SURVEY CONTROL ORDER

Horizontal	_____
Vertical	_____

WISCONSIN COORDINATE SYSTEM

Corner	East (X)	North (Y)	Elevation (Z)	Zone
Control Sta. Name				

City, Village or Town of LaGrange

County of Monroe

CERTIFICATE

CERTIFIED LAND CORNER

No. 98

Page 1

I, Harley Sime, do hereby certify that on the _____ day of _____ 19 74, I found (evidence) ~~(no evidence)~~ of the W 1/4 corner of Section 26, T18 N, R 1 W, Fourth Principal Meridian, and I re-established said corner according to the Wisconsin Statutes as shown and described hereon.

History of original corner establishment:

See Reverse Side For Maintenance

Description of corner evidence found:

Found an old 50" circumference oak tree at the corner location with an iron pipe 2½' East of tree as a reference iron.

Dated this 17 day of March 1975.

Harley Sime
COUNTY SURVEYOR
Title



COUNTY SURVEYOR FORM NO. 1

Description of corner and witness monuments, references and accessories used to perpetuate the original or re-established location of this corner:

The corner is an old oak tree still living with a reference iron 2½' East of the tree.

Witnesses to corner location:

- SURVEY CREW
- K. Pritzlaff - Survey Crew Chief
- D. Malliet
- B. Jung
- A. Lueck

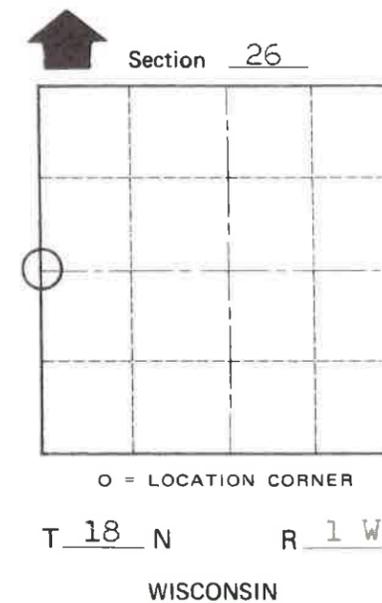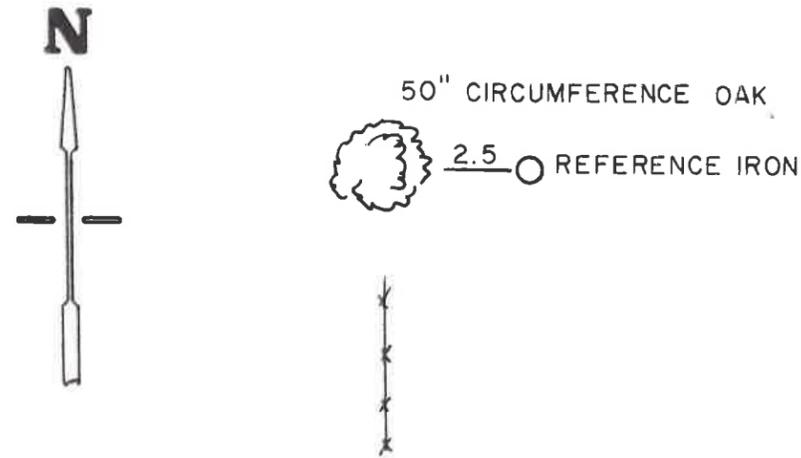

SURVEY CONTROL ORDER

Horizontal	_____
Vertical	_____

WISCONSIN COORDINATE SYSTEM

Corner	East (X)	North (Y)	Elevation (Z)	Zone
Control Sta. Name				

City, Village or Town La Grange

County of Monroe